



Operating Instructions and Parts Manual

Horizontal Band Saw

Model BS-250M



Baileigh Industrial
P.O. Box 531
Manitowoc, WI 54221-0531
Ph.: 920-684-4990
Fax: 920-684-3944
Baileigh-Sales@jpwindustries.com

Edition 3 07/2025
Copyright © 2022 Baileigh Industrial

1.0 Table of Contents

Section	Page
1.0 Table of Contents	2
2.0 Safety Instructions	4
3.0 About This Manual	5
4.0 Product Identification	6
4.1 Machine Base	7
4.2 Quick Clamp Vise	7
4.3 Swivel Saw Head	7
4.4 Overall Dimensions	8
5.0 Specifications	8
6.0 Setup and Assembly	9
6.1 Unpacking and Checking Contents	9
6.2 Cleaning	9
6.3 Transporting and Lifting	9
6.4 Installation	10
6.5 Anchoring the Machine	10
6.6 Assembly	10
7.0 Electrical Connections	11
7.1 Power Specifications	11
7.2 Considerations	11
7.3 Extension Cord Safety	11
7.4 Power Cord Connection	11
8.0 Adjustments	12
8.1 Replacing the Saw Blade	12
8.2 Setting Blade Tension	12
8.3 Adjusting the Blade Tracking	12
8.4 Adjusting the Blade Guide	13
8.5 Blade Guide Bearing Adjustment	13
9.0 Before Each Use	14
9.1 Whenever Saw is Running	14
9.2 Breaking in a Band Saw Blade	14
9.3 Metal Chip Indicators	14
9.4 Blade Terminology	14
9.5 Width of Blade	15
9.6 Length of Blade	15
9.7 Blade Structure	15
9.8 Blade Type	15
9.9 Sets	15
10.0 Blade Care	16
11.0 Choosing a Saw Blade	16
12.0 Blade Breakage	16
13.0 Operation	17

13.1	Manual Operation	17
13.2	Auto Mode Operation	17
14.0	Material Selection	18
15.0	Maintenance	18
15.1	Daily Maintenance	18
15.2	Weekly Maintenance	19
15.3	Monthly Maintenance	19
15.4	Oils for Lubricating Coolant	19
15.5	Coolant System Maintenance.....	19
15.6	Oil Disposal	19
15.7	Gearbox Maintenance	19
15.8	Storing Machine for Extended Period of Time	20
16.0	Troubleshooting	21
17.0	Replacement Parts	23
17.1.1	Horizontal Band Saw Assembly – Exploded View A.....	23
17.1.2	Horizontal Band Saw Assembly – Exploded View B	24
17.1.3	Horizontal Band Saw Assembly – Exploded View C	25
17.1.4	Horizontal Band Saw Assembly – Exploded View D	26
17.1.5	Horizontal Band Saw Assembly – Part List A-D	27
17.1.6	Horizontal Band Saw Assembly – Exploded View E	31
17.1.7	Horizontal Band Saw Assembly – Part List E	32
18.0	Wiring Diagram	33
19.0	Fault Displays	34
19.1	Error Trip Messages of Drive	34
19.2	Warning Messages of Drive.....	35
20.0	Warranty and Service.....	36



2.0 Safety Instructions

⚠ WARNING

Failure to follow these rules may result in serious personal injury

1. FOR YOUR OWN SAFETY, READ INSTRUCTION MANUAL BEFORE OPERATING THE MACHINE. Learn the machine's application and limitations as well as the specific hazards.
2. Only trained and qualified personnel can operate this machine.
3. Make sure guards are in place and in proper working order before operating machinery.
4. Remove any adjusting tools. Before operating the machine, make sure any adjusting tools have been removed.
5. Keep work area clean. Cluttered areas invite injuries.
6. Overloading machine. By overloading the machine you may cause injury from flying parts. DO NOT exceed the specified machine capacities.
7. Dressing material edges. Always chamfer and deburr all sharp edges.
8. Do not force tool. Your machine will do a better and safer job if used as intended. DO NOT use inappropriate attachments in an attempt to exceed the machines rated capacity.
9. Use the right tool for the job. DO NOT attempt to force a small tool or attachment to do the work of a large industrial tool. DO NOT use a tool for a purpose for which it was not intended.
10. Dress appropriate. DO NOT wear loose fitting clothing or jewelry as they can be caught in moving machine parts. Protective clothing and steel toe shoes are recommended when using machinery. Wear a restrictive hair covering to contain long hair.
11. Use eye protection. Always wear ISO approved protective eye wear when operating machinery. Wear a full-face shield if you are producing metal filings. Eye wear shall be impact resistant, protective safety glasses with side shields which comply with ANSI Z87.1 specification. Use of eye wear which does not comply with ANSI Z87.1 specification could result in severe injury from breakage of eye protection.
12. Do not overreach. Maintain proper footing and balance at all times. DO NOT reach over or across a running machine.
13. Stay alert. Watch what you are doing and use common sense. DO NOT operate any tool or machine when you are tired.
14. Check for damaged parts. Before using any tool or machine, carefully check any part that appears damaged. Check for alignment and binding of moving parts that may affect proper machine operation.
15. Observe work area conditions. DO NOT use machines or power tools in damp or wet locations. Do not expose to rain. Keep work area well lighted. DO NOT use electrically powered tools in the presence of flammable gases or liquids.
16. Blade adjustments and maintenance. Always keep blades sharp and properly adjusted for optimum performance.
17. Keep children away. Children must never be allowed in the work area. DO NOT let them handle machines, tools, or extension cords.
18. Store idle equipment. When not in use, tools must be stored in a dry location to inhibit rust. Always lock up tools and keep them out of reach of children.
19. DO NOT operate machine if under the influence of alcohol or drugs. Read warning labels on prescriptions. If there is any doubt, DO NOT operate the machine.
20. DO NOT touch live electrical components or parts.
21. Turn off power before checking, cleaning, or replacing any parts.
22. Be sure all equipment is properly installed and grounded according to national, state, and local codes.
23. Keep all cords dry, free from grease and oil, and protected from sparks and hot metal.
24. Inspect power and control cables periodically. Replace if damaged or bare wires are exposed. Bare wiring can kill!
25. DO NOT bypass or defeat any safety interlock systems.
26. Keep visitors a safe distance from the work area.

Familiarize yourself with the following safety notices used in this manual:

⚠ CAUTION

This means that if precautions are not heeded, it may result in minor injury and/or machine damage.

⚠ WARNING

This means that if precautions are not heeded, it may result in serious injury or death.

⚠ DANGER

This means that if precautions are not heeded, it will result in serious or fatal, injury.

Save the Instructions

3.0 About This Manual

This manual is provided by Baileigh Industrial, covering the safe operation and maintenance procedures for a Baileigh Model BS-250M Horizontal Band Saw. This manual contains instructions on installation, safety precautions, general operating procedures, maintenance instructions and parts breakdown. Your machine has been designed and constructed to provide consistent, long-term operation if used in accordance with the instructions as set forth in this document.

Technical Support handles questions on setup, operation, schematics, warranty issues, and individual parts needed. Our Technical Support department can be reached at 920-684-4990.

If there are questions or comments, please contact your local supplier or Baileigh Industrial. We can also be reached at our web site: www.baileigh.com.

Retain this manual for future reference. If the machine transfers ownership, the manual should accompany it.

⚠ WARNING

Read and understand the entire contents of this manual before attempting assembly or operation! Failure to comply may cause serious injury!

Register your product online -

<https://baileigh.com/product-registration>



4.0 Product Identification

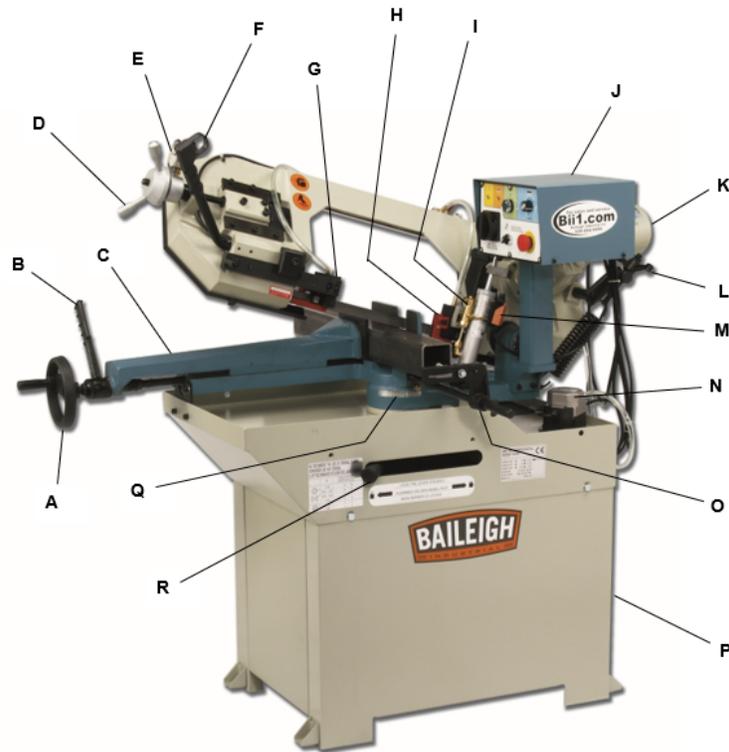


Figure 4-1

Table 4-1

Item	Description	Function
A	Vise Hand Wheel	Turning hand-wheel opens and closes vise
B	Vise Lever	To quickly clamp and unclamp material
C	Vise	Holds front and rear jaws for clamping
D	Blade Tension Hand Wheel	For applying and releasing blade tension
E	Blade Tension Gauge	Reads tension in Kgs/cm ²
F	Trigger Switch	For starting saw motor in manual mode
G	Blade Adjustment Assembly	Adjusts front end of blade
H	Blade Adjustment Assembly	Adjusts rear end of blade
I	Ball Valve	Starts and stops the blade descent
J	Control Box	Houses the operator controls
K	Motor/Gearbox	Drives the saw blade
L	Spring Adjustment Knob	Sets spring tension
M	Micro Switch	Shuts off saw when finished cutting
N	Coolant Pump	Recirculates blade coolant
O	Stop Rod Assembly	For setting the length of cut
P	Saw Stand	Supports the saw assembly
Q	Angle Indicator	Shows angular cutting degrees
R	Miter Lock Lever	Tightens and loosens table to set angles



Figure 4-2

1. Power Indicator Light: (Lights “white” when power is on).
2. Start Pushbutton: (Starts saw motor in Auto mode).
3. E-Stop Pushbutton: (Saw can be stopped immediately by pressing the red mushroom cap button) Twist the button clockwise (cw) to reset. Resetting the E-Stop will not start the saw.
4. Speed Control: (Sets blade speed from 20-85 mpm) Has an OFF position to shut off power.
5. Main Disconnect Switch: (Turns power ON to the saw) Can be locked out in the OFF position for Safety or Security.
6. 2-Position Mode Switch: (Selects between auto mode, clockwise (cw) and trigger control, counterclockwise (ccw).
7. Blade Speed Display: Indicates the approximate speed of the blade in MPM (meters per minute).

4.1 Machine Base

After assembly, the machine base becomes the structure that supports the saw bow, the vise, the coolant pump, the bar stop, the swing arm, and the roller for supporting material.



Figure 4-3

4.2 Quick Clamp Vise

Place the piece part between the vise jaws and have it rest next to the fixed vise jaw. Rotate the hand wheel (A) clockwise (cw) to close the front jaw onto the piece and tighten. Rotate the hand wheel counterclockwise (ccw) to release. Vise lever (B) can be used to quickly lock and release the piece part by allowing a small gap between the vise and part. Then rotate lever (B) counterclockwise (ccw) to lock and clockwise (cw) to release.

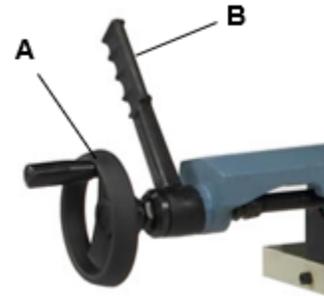


Figure 4-4

4.3 Swivel Saw Head

Angles can be cut up to 60° (Right). Unlock the rotating saw head by pushing the miter lock lever (R) to the left. Rotate the saw head to the desired angle as shown on the angle indicator (Q). Lock the saw head by pushing the lock lever (R) to the right.

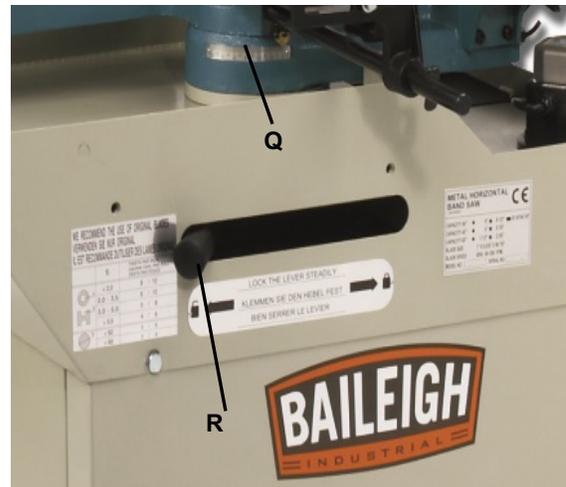


Figure 4-5

IMPORTANT: Check that the saw blade clears all parts of the vise assembly before cutting. The blade can strike parts of the assembly (especially during miter cuts) if not properly adjusted. Make sure saw bow is in a down or horizontal position when moving or mitering to avoid tipping over machine.

4.4 Overall Dimensions

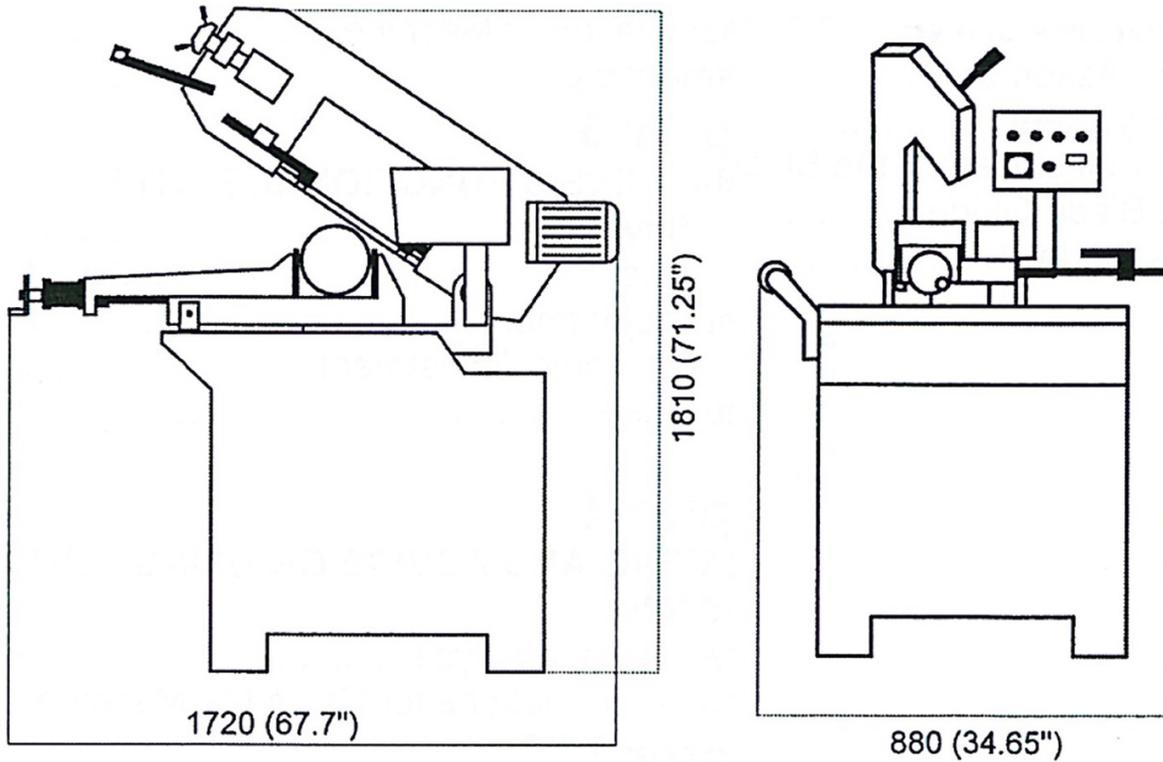


Figure 4-6

5.0 Specifications

Table 5-1

Model number	BS-250M
Motor and Power	
Power Input	110V, 60Hz, 1-Phase
Main Motor	220V, 60hz, 3Ph, 4.7A, 1.1kw, 1720rpm
General Specifications	
Capacity Rectangular 90°	10.25" x 4.25" (260 x 110mm)
Capacity Round 90° / 45° / 60°	8.66" / 6" / 3.5" (220 / 150 / 90mm)
Capacity Square 90° / 45° / 60°	8.46" / 5.875" / 3.375" (215 / 145 / 85mm)
Return	Manual
Miter Adjustment	Swivel Head
Miter Angle	0 - 60°
Blade Size (H x T x L)	1" x .035" x 96.85" (27 x .9 x 2460mm)
Blade Speed (fpm)	66 – 280fpm (20 – 85mpm) Variable
Blade Guide	Carbide x Roller
Table Height	33.07" (840mm)
Drive	Gear
Descent Control	Hydraulic
Coolant Pump	110V, 60Hz, 1Ph, .35A, 32W, 2800rpm
Weights and Dimensions	
Shipping Weight	550lbs (250kgs)
Shipping Dimensions	61" x 29" x 36.25" (1549 x 737 x 921mm)

⚠ WARNING

Read and understand the entire contents of this manual before attempting assembly or operation. Failure to comply may cause serious injury.

6.0 Setup and Assembly

6.1 Unpacking and Checking Contents

Your Baileigh Industrial machine is shipped complete. Separate all parts from the packing material and check each item carefully. Make certain all items are accounted for before discarding any packing material.

⚠ WARNING

SUFFOCATION HAZARD! Immediately discard any plastic bags and packing materials to eliminate choking and suffocation hazards to children and animals.

⚠ WARNING

If any parts are missing, **DO NOT** place the machine into service until the missing parts are obtained and installed correctly.

6.2 Cleaning

⚠ WARNING

DO NOT USE gasoline or other petroleum products to clean the machine. They have low flash points and can explode or cause fire.

⚠ CAUTION

When using cleaning solvents work in a well-ventilated area. Many cleaning solvents are toxic if inhaled.

Your machine may be shipped with a rustproof waxy coating and/or grease on the exposed unpainted metal surfaces. Fully and completely remove this protective coating using a degreaser or solvent cleaner. Moving items will need to be moved along their travel path to allow for cleaning the entire surface. For a more thorough cleaning, some parts will occasionally have to be removed. **DO NOT USE** acetone or brake cleaner as they may damage painted surfaces.

Follow manufacturer's label instructions when using any type of cleaning product. After cleaning, wipe unpainted metal surfaces with a light coating of quality oil or grease for protection.

IMPORTANT: This waxy coating is **NOT** a lubricant and will cause the machine to stick and lose performance as the coating continues to dry.

6.3 Transporting and Lifting

NOTICE

Lifting and carrying operations should be carried out by skilled workers, such as a truck operator, crane operator, etc. If a crane is used to lift the machine, attach the lifting chain carefully, making sure the machine is well balanced.

Follow these guidelines when lifting with truck or trolley:

- The lift truck must be able to lift at least 1.5 – 2 times the machines gross weight.
- Make sure the machine is balanced. While transporting, avoid rough or jerky motion, and maintain a safe clearance zone around the transport area.
- Use a forklift with sufficient lifting capacity and forks that are long enough to reach the complete width of the machine.
- Remove the securing bolts that attach the machine to the pallet.
- Approaching the machine from the side, lift the machine on the frame taking care that there are no cables or pipes in the area of the forks.
- Move the machine to the required position and lower gently to the floor.
- Level the machine so that all the supporting feet are taking the weight of the machine and no rocking is taking place.

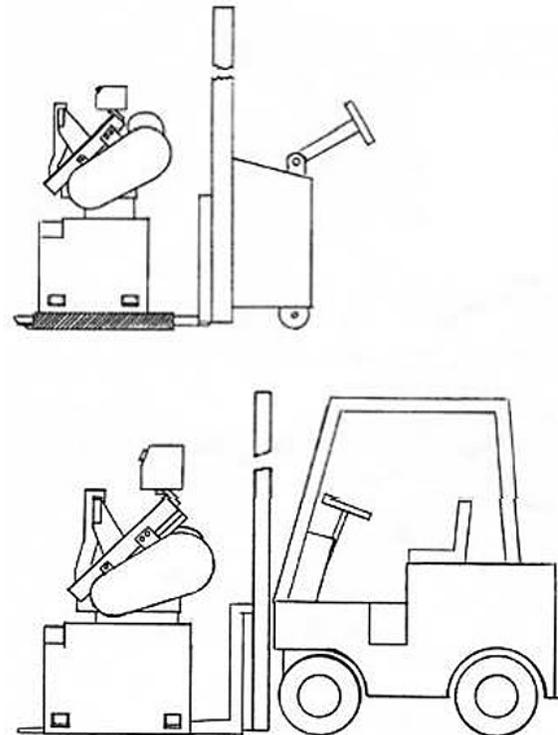


Figure 6-1

6.4 Installation

IMPORTANT:

Consider the following when looking for a suitable location to place the machine:

- Overall weight of the machine.
- Weight of material being processed.
- sizes of material to be processed through the machine.
- Space needed for auxiliary stands, worktables, or other machinery.
- Clearance from walls and other obstacles.
- Maintain an adequate working area around the machine for safety.
- Have the work area well illuminated with proper lighting.
- Keep the floor free of oil and make sure it is not slippery.
- Remove scrap and waste materials regularly, and make sure the work area is free from obstructing objects.
- If long lengths of material are to be fed into the machine, make sure that they will not extend into any aisles.
- **LEVELING:** The machine should be sited on a level, concrete floor. Provisions for securing it should be in position prior to placing the machine. The accuracy of any machine depends on the precise placement of it to the mounting surface.
- **FLOOR:** This machine distributes a large amount of weight over a small area. Make certain that the floor is capable of supporting the weight of the machine, work stock, and the operator. The floor should also be a level surface. If the unit wobbles or rocks once in place, be sure to eliminate by using shims.
- **WORKING CLEARANCES:** Take into consideration the size of the material to be processed. Make sure that you allow enough space for you to operate the machine freely.
- **POWER SUPPLY PLACEMENT:** The power supply should be located close enough to the machine so that the power cord is not in an area where it would cause a tripping hazard. Be sure to observe all electrical codes if installing new circuits and/or outlets.

6.5 Anchoring the Machine

- Once positioned, anchor the machine to the floor, as shown in the diagram. Use bolts and expansion plugs or sunken tie rods that connect through and are sized for the holes in the base of the stand.
- This machine requires a solid floor such as concrete at a minimum of 4" (102mm) thick. 6" (153mm) minimum is preferred.

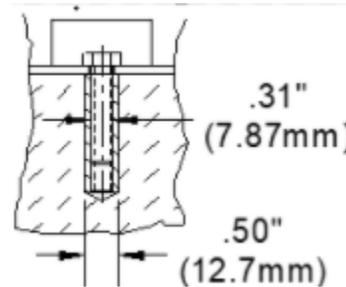


Figure 6-2

6.6 Assembly

Assemble the stand as shown in the BS-250M – Exploded View A, of this manual. (Make sure all nuts and bolts are properly tightened). Use a sling capable of lifting 500 lbs. (min.) and make sure the load is properly balanced. Pick up the saw and carefully set it onto the stand and bolt together. Attach electrical control box (J) to the pedestal (S) with (4) hex socket capscrews.



Figure 6-3

6.6.1 Return Stroke Limiting Device

A hydraulic cylinder is used to control the drop rate of the saw bow. The hydraulic cylinder is ideal when cutting thin walled or stainless steel sections as they require a constant drop rate to achieve a fine cut edge.

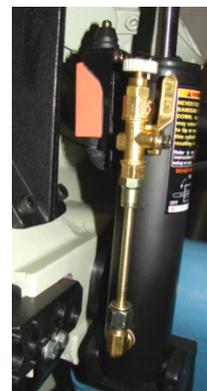


Figure 6-4

6.6.2 Support Roller

A device that helps support longer sized material. The roller assists stock moving through the vise. It is adjustable by loosening (2) hex bolts.

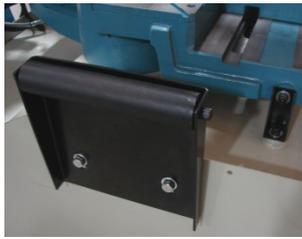


Figure 6-5

6.6.3 Stop Rod Assembly

The stop rod is used when cutting duplicate parts thus eliminating the need to measure each piece.



Figure 6-6

7.0 Electrical Connections

⚠ CAUTION

HAVE ELECTRICAL UTILITIES CONNECTED TO MACHINE BY A CERTIFIED ELECTRICIAN!

Check if the available power supply is the same as listed on the machine nameplate.

⚠ WARNING

Make sure the grounding wire (green) is properly connected to avoid electric shock. DO NOT switch the position of the green grounding wire if any electrical plug wires are switched during hookup.

7.1 Power Specifications

Your machine is wired for 220 volts, 60hz alternating current. Before connecting the machine to the power source, make sure the power source is OFF.

Before switching on the power, you must check the voltage and frequency of the power to see if they meet with the requirement, the allowed range for the voltage is $\pm 5\%$, and for the frequency is $\pm 1\%$.

7.2 Considerations

- Observe local electrical codes when connecting the machine.
- The circuit should be protected with a time delay fuse or circuit breaker with an amperage rating slightly higher than the full load current of machine.
- A separate electrical circuit should be used for your machines. Before connecting the motor to the power line, make sure the switch is in the "OFF" position and be sure that the electric

current is of the same characteristics as indicated on the machine.

- All line connections should make good contact. Running on low voltage will damage the motor.
- In the event of a malfunction or breakdown, grounding provides a path of least resistance for electric current to reduce the risk of electric shock. This machine is equipped with an electric cord having an equipment-grounding conductor and a grounding plug. The plug must be plugged into a matching outlet that is properly installed and grounded in accordance with all local codes and ordinances.

⚠ WARNING

In all cases, make certain the receptacle in question is properly grounded. If you are not sure, have a qualified electrician check the receptacle.

- Improper connection of the equipment-grounding conductor can result in risk of electric shock. The conductor with insulation having an outer surface that is green with or without yellow stripes is the equipment-grounding conductor. If repair or replacement of the electric cord or plug is necessary, do not connect the equipment-grounding conductor to a live terminal.
- Check with qualified electrician or service personnel if the grounding instructions are not completely understood, or if in doubt as to whether the machine is properly grounded.
- Repair or replace damaged or worn cord immediately.

7.3 Extension Cord Safety

Extension cord should be in good condition and meet the minimum wire gauge requirements listed below:

Table 7-1

Amp Rating	Length		
	25ft	50ft	100ft
1-12	16	16	14
13-16	14	12	12
17-20	12	12	10
21-30	10	10	No
Wire Gauge			

An undersized cord decreases line voltage, causing loss of power and overheating. All cords should use a ground wire and plug pin. Replace any damaged cords immediately.

7.4 Power Cord Connection

1. Turn the main disconnect switch on the control panel to the OFF position.

2. Unwrap the power cord and route the cord away from the table toward the power supply.
 - a. Route the power cord so that it will NOT become entangled in the saw bow, saw blade, or counterbalance assembly in any way.
 - b. Route the cord to the power supply in a way that Does NOT create a trip hazard.
3. Connect the power cord to the power supply and check that the power cord has not been damaged during installation.
4. When the saw blade is clear of any obstruction and raised up off of the limit switch. The main disconnect may be turned ON to test the saw operation. Turn the main disconnect to OFF when the saw is not in operation.

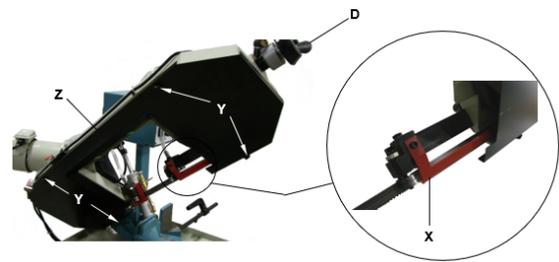


Figure 8-2

8.2 Setting Blade Tension

Blade tension is important to the proper operation of the saw. Correct blade tension is 1200 kg/cm² as measured on the saw's tension gauge.

Turning the handwheel (D) clockwise (cw) will increase the tension. Counterclockwise (ccw) will decrease tension of the saw blade.



Figure 8-3

8.0 Adjustments

⚠ WARNING

Make sure the electrical disconnect is OFF before working on the machine.

⚠ WARNING

Always follow proper safety precautions when working on or around any machinery.

8.1 Replacing the Saw Blade

Wear gloves when handling the saw blade.

1. Raise the saw bow.
2. Remove the front blade guard (X) and the (4) knobs (Y) holding on the main blade guard. (Carefully pull out the tongue from the safety interlock switch)
3. Loosen the saw blade with the tension hand wheel (D) and remove it from the flywheels and the blade guide blocks.
4. Assemble the new blade by placing it first between the guide blocks and then on the face of the flywheels. (note blade direction)
5. Tension the blade, making sure it seats properly on the flywheels.
6. Reassemble the front blade guide (X) and the main blade guard (Z), making sure the switch tongue engages the switch or the saw will not start.

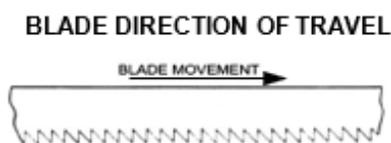


Figure 8-1

8.3 Adjusting the Blade Tracking

The flywheels alignment may need some adjustment to allow the saw blade to track correctly. Improper flywheel alignment can cause damage to the saw blade or cause it to ride off the blade wheel bearings.

1. Disconnect power from the saw.
2. Raise the saw bow to a usable work height.
3. Loosen the hex socket cap screws (X, Y, & Z).
4. Use an Allen wrench on setscrew (AA) to adjust the tilt of the flywheel. make the distance between the flywheel and the back of blade are approximately 0.012"~0.019" (0.30~0.50mm), as shown.
5. Turning the setscrew (AA) clockwise (cw) will tilt flywheel so that the blade will ride closer to the flange.
6. Turning the setscrew (AA) counterclockwise (ccw) will tilt the flywheel so that the blade will ride away from the flange. (If it rides too far away it will come off).
7. After the adjustment is finished, tighten the socket cap screws in this order: (X, Y, & Z).

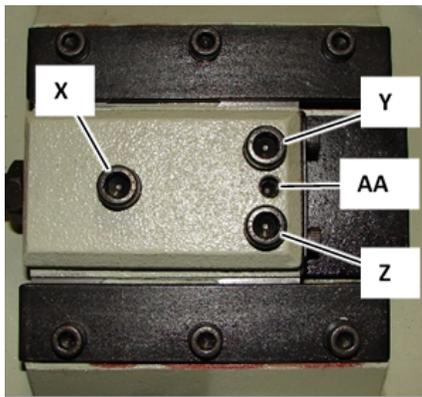


Figure 8-4

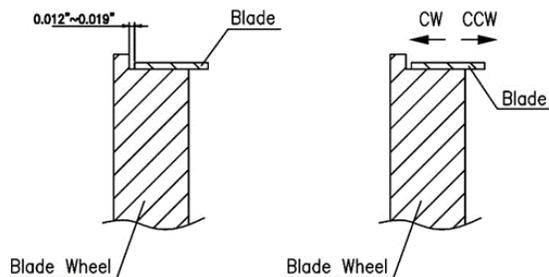


Figure 8-5

8.4 Adjusting the Blade Guide

1. Disconnect Power From the Saw
2. Release the extension bar for the blade guide block by loosening socket capscrew (AC) counterclockwise (ccw) and freeing up the clamping block (AD).
3. Hold the handle (AB) and slide the blade guide block as close as possible to the piece part without interfering with the cut.
4. Tighten socket screw (AC) clockwise (cw).

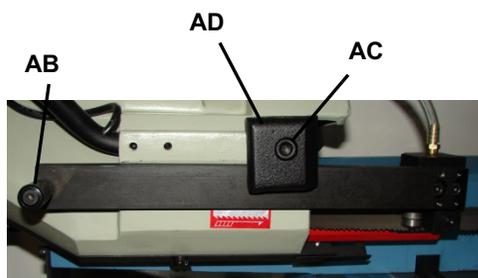


Figure 8-6

8.5 Blade Guide Bearing Adjustment

IMPORTANT: This is the most important adjustment on your saw. It is impossible to get satisfactory work from your saw if the blade guides are not properly adjusted. Your Baileigh Industrial Band Saw has been adjusted and power tested before leaving the factory to insure proper setting. If the guides do get out of adjustment, it is extremely important to re-adjust immediately. An improperly

adjusted blade will not cut straight and serious blade damage may result. It is always best to try a new blade to see if this will correct poor cutting before beginning to adjust the blade guide bearings. If the blade becomes dull on one side and not the other, for example, it will begin cutting crooked. A blade change will correct this problem; the guide adjustment will not. If a new blade does not correct the problem, check the clearance between the blade and guides.

1. Disconnect Power From the Saw.
2. Loosen nut (AK), screw (AJ), and loosen dowel (AL) which widens the gap between the pads.
3. Loosen the nuts (AP) and the dowels (AQ) and then rotate the pins (AM) and (AO) to widen the gap between the bearings (AN).
4. To mount the new blade, place the pad (AI) on the blade. Loosen the dowel and allow a distance of .001" for the sliding of the blade. Lock the nut and screw (AJ). Rotate the pins (AM) and (AO) until the bearings rest against the blade as indicated in (figure 14) and then secure the dowels (AQ) and nuts (AP).
5. Make sure that between the blade and the upper teeth of the pad (AH) there is at least .008" - .011" (2-3mm) of play. If necessary, loosen the screws that fasten the blocks and adjust accordingly.

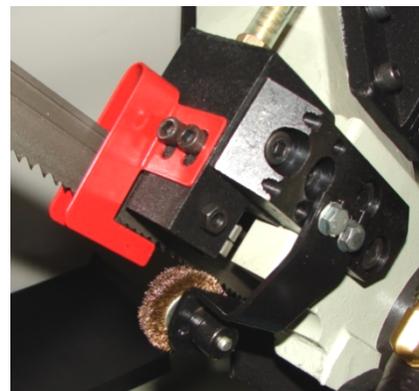


Figure 8-7

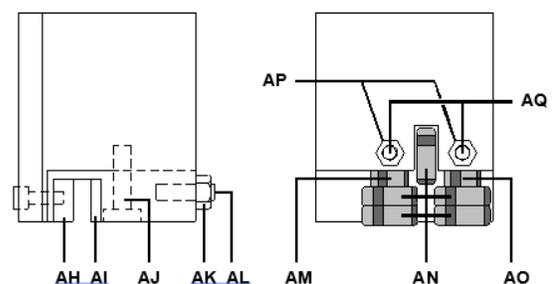


Figure 8-8

9.0 Before Each Use

- For dusty operations, wear a face shield along with safety goggles.
- It is important to choose the right blade for the material and the type of cutting you plan to do. This saw is equipped with a bi-metallic blade which can be used to cut stainless steel, steel, iron, brass, aluminum, wood, plastic.
- Make sure the direction of rotation arrow on the blade matches the direction arrow on the saw. The blade teeth should always point downward at the front of the saw.
- Make sure the blade is sharp, undamaged and properly aligned. With the saw unplugged, push the power-head all the way down. Rotate the blade by hand checking for clearance. If the blade hits anything, make the adjustments shown in the Maintaining Maximum Cutting Capacity section.
- Never cut freehand.
- Make sure the cut-off piece can move sideways after it is cut off. Otherwise, it could get wedged against the blade and thrown violently.
- Never turn the saw "ON" before clearing everything except the work piece beneath the blade.
- Never put lubricants on the blade while it is spinning.

9.1 Whenever Saw is Running

- Never confine the piece being cut out.
- Never hold it, clamp it, touch it, or use length stops against it. It must be free to move sideways. If confined, it could get wedged against the blade and thrown violently.
- Avoid awkward hand positions where a sudden slip could cause a hand to move into the blade.
- Let the blade reach full speed before cutting.
- Feed the saw into the work piece only fast enough to let the blade cut without bogging down or binding.
- Before freeing jammed material, turn the switch off and unplug the saw. Wait for all moving parts to stop.
- After finishing a cut, keep holding the saw bow down, release the switch, and wait for all moving parts to stop before moving your hands.

9.2 Breaking in a Band Saw Blade

Sharp cutting edges with extremely small edge radii are required for high cutting capacity. To achieve the optimal tool life we recommend breaking-in the blade accordingly. The correct cutting speed is determined by the material being cut and its dimensions. It is very important that the new blade is first used with only 50% of the determined feed rate. This will avoid micro-breakages of the blade because of too large chip thicknesses. New band

saw blades may tend toward vibrations and vibration sounds. In this case a slight reduction of the cutting speed is helpful. With small workpiece dimensions approximately 300cm² of the material should be cut for breaking-in. If large work piece dimensions are to be cut we recommend a breaking-in period of about 15 minutes. After breaking-in you may slowly increase the feed rate up to the determined value.

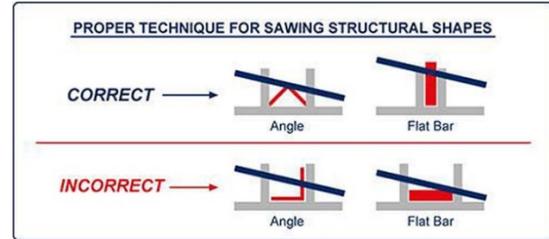


Figure 9-1

9.3 Metal Chip Indicators

Chips are the best indicator of correct material feed force. Monitor chip information and adjust feed accordingly.

- Thin or Powdered Chips – increase feed rate or reduce saw speed
- Burned Chips – reduce feed rate and / or saw speed
- Curly Silvery and Warm Chips – optimum feed rate and saw speed

Baileigh Industrial offers a wide selection of tooth styles for various cutting applications. Please phone Baileigh Industrial at (920.684.4990) or fax to (920.684.3944) to have one of our technicians assist you in selecting the proper band saw blade for your cutting applications.

9.4 Blade Terminology

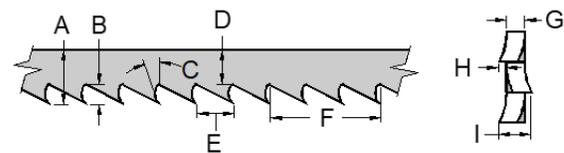


Figure 9-2

Table 9-1

Item	Description	Function
A	BLADE WIDTH	The widest part of the blade measured from the back edge of the blade to the tip of the tooth.
B	GULLET DEPTH	The distance from the tooth tip to the bottom of the curved area.
C	TOOTH RAKE	The angle of the tooth face from a line perpendicular to the length of the blade.

Item	Description	Function
D	BLADE BACK	The distance between the back edge of the blade and the bottom of the gullet.
E	TOOTH PITCH	The distance between tooth tips.
F	TPI	The number of teeth per inch when measured from gullet to gullet.
G	GAUGE	The thickness of the blade.
H	TOOTH SET	The distance a tooth is bent from the blade.
I	KERF	The width of material that is removed by the blade when cutting.

9.5 Width of Blade

The blade width determines the largest and the smallest curve that can be cut. Usually the wider a blade is, the more accurate and straighter it will cut.

9.6 Length of Blade

The length of the band saw blade can be measured with a tape measure at its circumference or by the formula below:

$$\text{Blade Length} = (2 \times A) + (3.14 \times B)$$

A = the distance in inches between the band saw pulley centers (when the upper pulley is midway in its adjustment range).

B = the band saw pulley diameter.

9.7 Blade Structure

Bi-metal blades are the most commonly used. They consist of a silicon-steel blade backing by a laser welded high speed steel (HSS) cutting edge. The type of stocks are classified in M2, M42, M51 and differ from each other because of their major hardness due to the increasing percentage of Cobalt (Cc) and molybdenum (Mo) contained in the metal alloy.

9.8 Blade Type

They differ essentially in their constructive characteristics, such as:

- Shape and cutting angle of tooth
- Pitch
- Set

Shape and angle of tooth

REGULAR TOOTH: 0° rake and constant pitch.



Figure 9-3

Most common form for transversal or inclined cutting of solid small and average cross-sections or

pipes, in laminated mild steel and gray iron or general metal.

POSITIVE RAKE TOOTH: 9° - 10° positive rake and constant pitch.

 


Figure 9-4

Particular use for crosswise or inclined cuts in solid sections or large pipes, but above all harder materials (highly alloyed and stainless steels, special bronze and forge pig iron).

COMBO TOOTH: pitch varies between teeth and consequently varying teeth size and varying gullet depths. Pitch varies between teeth, which ensures a smoother, quieter cut and longer blade life owing to the lack of vibration.

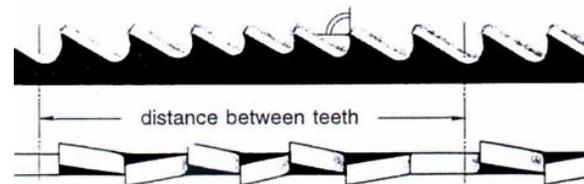


Figure 9-5

Another advantage offered in the use of this type of blade in the fact that with an only blade it is possible to cut a wide range of different materials in size and type.

COMBO TOOTH: 9° - 10° positive rake.

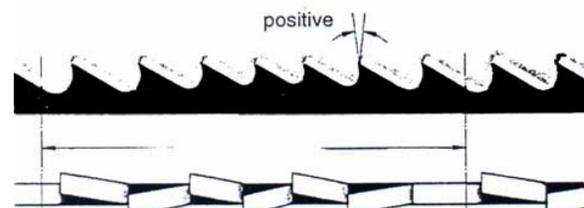


Figure 9-6

This type of blade is the most suitable for the cutting of section bars and large and thick pipes as well as for the cutting of solid bars at maximum machine capacity. Available pitches: 3-4/4-6.

9.9 Sets

Saw teeth bent out of the plane of the saw body, resulting in a wide cut in the workpiece.

 


Figure 9-7

REGULAR OR RAKER SET: Cutting teeth right and left, alternated by a straight tooth.



Figure 9-8

Of general use for materials with dimensions superior to 5 mm. Used for the cutting of steel, castings and hard nonferrous materials.

WAVY SET: Set in smooth waves.



Figure 9-9

This set is associated with very fine teeth and it is mainly used for the cutting of pipes and thin section bars (from 1 to 3 mm).

ALTERNATE SET (IN GROUPS): Groups of cutting teeth right and left, alternated by a straight tooth.



Figure 9-10

This set is associated with very fine teeth and it is used for extremely thin materials (less than 1mm).

ALTERNATE SET (INDIVIDUAL TEETH): Cutting teeth right and left.



Figure 9-11

This set is used for the cutting of nonferrous soft materials, plastics and wood.

10.0 Blade Care

The bandsaw blade is subjected to a tremendous amount of strain. Make sure to always use the appropriate feed rate for the type material you are cutting.

Be sure to select a blade of the proper width, style, and pitch that will produce the best cut in your material. Choosing the wrong blade can produce excess heat that can adversely affect the life of the blade.

A clean blade performs much better than one that is dirty. Blades that are gummed up and dirty offer more resistance when cutting through the material. This in turn creates unnecessary heat in the blade.

11.0 Choosing a Saw Blade

A general purpose blade is furnished with this band saw.

To achieve a quality, economical, and efficient saw cut, the following points must be taken into consideration:

- Type of material being cut (ferrous or non-ferrous)
- Material hardness and physical dimensions
- Blade descent rate
- Longitudinal speed of blade
- Blade tooth profile

Choose a tooth pitch that is suitable for the workpiece. Thin walled profiles, including tubes and pipes require close toothing. At least 3-6 teeth should be in contact with the material while cutting. Large solid or transverse sections require widely spaced toothing to allow for greater volume of chips and better tooth penetration. Soft materials such as

plastics, light alloys, mild bronze, Teflon, etc. require widely spaced toothing to avoid clogging.

S	0.787	1.574	2.362	3.15	4	4.724	6	7.873	11.811	15.75	19.685	23.621	27.5	31.5	35.5	39.5	59
0.079	14	14	14	14	14	14	10-14tpi	10-14tpi	8-12tpi	8-12tpi	6-10tpi	6-10tpi	5-8tpi	5-8tpi	5-8tpi	5-8tpi	5-8tpi
0.118	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	5-8tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.157	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.197	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.236	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.315	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.394	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.472	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.591	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
0.787	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
1.181	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
2	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
3	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
4	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
6	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
7.873	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
9.842	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
11.81	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
13.778	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
15.747	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
17.716	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi
19.685	14	14	14	14	14	14	10-14tpi	8-12tpi	8-12tpi	6-10tpi	5-8tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi	4-6tpi

Figure 11-1

S= Wall Thickness
If you have to cut two or more tubes lying side by side please use this table in consideration of the double wall thickness (s).

12.0 Blade Breakage

In some cases, blade breakage is unavoidable due to the stresses that are imparted on the blade. Avoidable breakage is often the result of poor care, or poor operator judgment when it comes to adjusting or mounting the blade or blade guides.

Listed below are some of the more common reasons for blade breakage.

- Top blade guide assembly is set too high above the piece part.

- The blade is tensioned incorrectly.
- Piece part is fed into the blade too quickly.
- Blade teeth are dull or broken.
- Blade is not properly aligned with the guides.
- Forcing a large width blade to cut a small radius.
- Using a blade with an improperly finished weld joint.
- Allowing the blade to run when not in use. (NEVER leave an unattended blade running.)

13.0 Operation

⚠ CAUTION

Always wear proper eye protection with side shields, safety footwear, and leather gloves to protect from burrs and sharp edges.

⚠ CAUTION

NEVER operate saw without blade guards in place.

13.1 Manual Operation

1. Close the handle on the hydraulic ball valve (I) by turning it counterclockwise (ccw).
2. Turn the flow control knob (AO) clockwise (cw) to shut off the hydraulic flow. This will prevent the saw bow from dropping when the ball valve is opened.
3. Reduce the bow weight. Rotate the wing nut (AP) clockwise (cw) to increase the tension on the spring.
4. Load piece part and clamp securely.
5. Turn the main switch (5) to "ON". Check to see that the indicator light (1) is lit.
6. Set the blade speed with control knob (4).
7. Set switch (6) to manual mode for trigger operation.
8. While firmly holding the control handle of the saw bow, open ball valve (I) clockwise (cw).
9. Fully open the flow control knob (AO) counterclockwise (ccw).
10. Squeeze the start trigger to energize the blade motor and lower saw bow to begin cutting.
11. When the saw bow reaches bottom limit, the micro switch (M) is actuated and shuts off the saw motor.
12. Return the saw bow to its start position and close ball valve (I).
13. Unclamp and reset the piece part to continue the next cutting cycle.



Figure 13-1

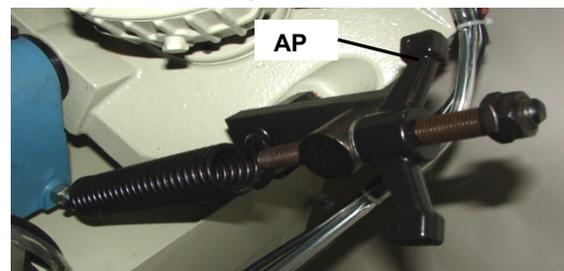


Figure 13-2

IMPORTANT: If an emergency situation should occur: Press the emergency STOP button (3) to immediately shut off all functions of the saw.



Figure 13-3

13.2 Auto Mode Operation

1. Close the handle on the hydraulic ball valve (I) by turning it counterclockwise (ccw).

2. Turn the flow control knob (AO) clockwise (cw) to shut off the hydraulic flow. This will prevent the saw bow from dropping when the ball valve is opened.
3. Increase the bow weight. Rotate the wing nut (AP) counterclockwise (ccw) to decrease the tension on the spring.
4. Load piece part and clamp securely.
5. Turn the main switch (5) to "ON". (Check to see that indicator light (1) is lit)
6. Set the blade speed with control knob (4)
7. Set switch (6) clockwise (cw) to auto mode for hydraulic cylinder operation.
8. Press the green start button (2). The saw motor and the coolant pump motor should both start.
9. Open the ball valve (I) clockwise (cw).
10. Turn the flow control knob (AO) clockwise (cw) to slow down the descent or counterclockwise (ccw) to speed it up.
11. When saw bow reaches bottom limit, micro switch (M) is actuated and shuts off the saw and pump motors.
12. Grasp the control handle and lift the saw bow to a height slightly above the piece part to minimize the next cut entry time.
13. Close ball valve (I).
14. Unclamp and reset the piece part to continue the next cutting cycle.

These examples below show ways to clamp a variety of cross sections. Always keep in mind the cutting capacity of the saw to achieve efficient saw cuts and long blade life. Do not use blades of a size different from that shown in the technical specification chart.

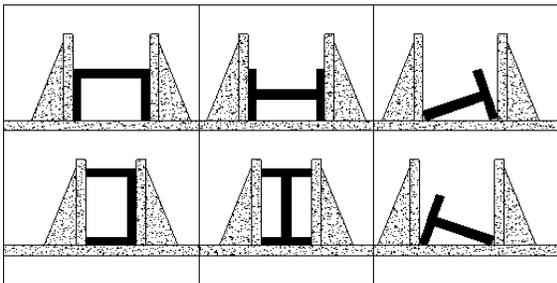


Figure 13-4

14.0 Material Selection

⚠ CAUTION

It must be determined by the customer that materials being processed through the machine are **NOT** potentially hazardous to operator or personnel working nearby.

When selecting materials keep these instructions in mind:

- Material must be clean and dry. (without oil)
- Material should have a smooth surface so it processes easily.
- Dimensional properties of material must be consistent and not exceed the machine capacity values.
- Chemical structure of material must be consistent.
- Buy certificated steel from the same vendor when possible.

15.0 Maintenance

⚠ WARNING

Make sure the electrical disconnect is OFF before working on the machine.

⚠ WARNING

Maintenance should be performed on a regular basis by qualified personnel.

⚠ WARNING

Always follow proper safety precautions when working on or around any machinery.

15.1 Daily Maintenance

- Check daily for any unsafe conditions and fix immediately.
- Check that all nuts and bolts are properly tightened.
- Do a general cleaning by removing dust and metal chips from the machine.
- Inspect the saw blade for wear.
- Clean the lubricating coolant drain screen.
- Top off the coolant tank.
- Check that the blade guards and emergency stop button are in good working order.
- When through using saw for the day, raise the bow to its up position and release some of the blade tension.

15.2 Weekly Maintenance

- On a weekly basis clean the machine and the area around it.
- Apply rust inhibitive lubricant to all non-painted surfaces.
- Wipe and grease the vise screw and sliding surfaces.
- Inspect blade brush and clean if needed.
- Clean coolant pump strainer basket.
- Remove chips from inside the guard housing for the saw blade.
- Use compressed air to clean the blade guides and guide bearings.

15.3 Monthly Maintenance

- Check the tightening of the motor flywheel screws.
- Check the blade guide bearings for wear. (replace if necessary).
- Tighten any loose bolts or screws on the gear motor, pump, and safety switches.
- Clean coolant tank.
- Grease saw head pivot.

15.4 Oils for Lubricating Coolant

Any 10:1 (water to coolant) solution will work, however we recommend Baileigh Industrial B-Cool 20:1 (water to coolant) biodegradable metal cutting fluid. It has excellent cooling and heat transfer characteristics, is non-flammable, and extends blade and machine life. Each gallon of concentrate makes 21 gallons of coolant.

15.5 Coolant System Maintenance

1. Disconnect Power from the Saw!
2. To clean the tank, first remove the pipe plug (AQ) to drain the coolant.
3. Take off the screen (AR) by removing (4) screws.
4. Remove the pump (AS) by taking out (2) socket cap screws.
5. After tank is completely drained use a vacuum cleaner to remove all chips and debris.
6. Replace the plug.
7. Thoroughly clean the pump (AS) and replace.
8. Fill the tank with coolant to approximately 1" below the screen.
9. Replace the screen (AR).
10. Removable drip tray (AT) shown in place.

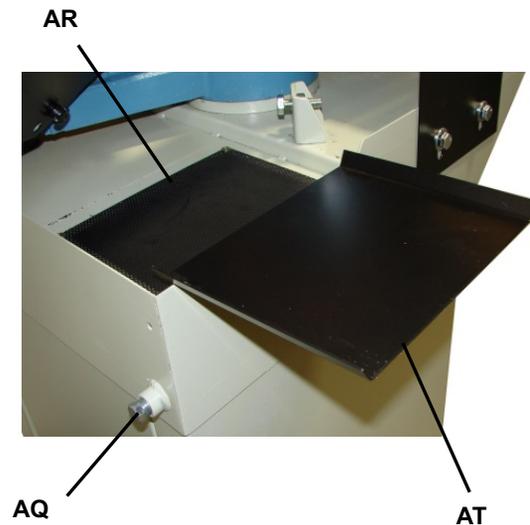


Figure 15-1

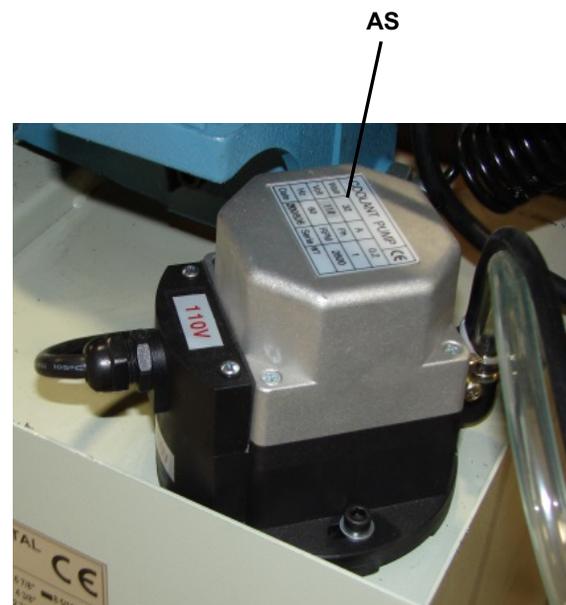


Figure 15-2

15.6 Oil Disposal

Used oil products must be disposed of in a proper manner following your local regulations.

15.7 Gearbox Maintenance

The gearbox requires periodic changing of the oil. Complete the first change after the initial 6 months of operation and then change annually thereafter.

1. Disconnect Power from the Saw!
2. Raise the saw bow to a vertical position. Note: You may have to back off the upper travel adjusting bolt.
3. Remove the oil drain plug (AU) and drain the oil into a catch basin. Loosening oil fill plug (AV) will help oil to drain.
4. After draining, replace drain plug (AU).

5. Return the saw bow to a horizontal position.
6. Remove the fill plug (AV) and add 0.32 quart of gear oil. (For reference use SHELL type gear oil or Mobil gear oil #90).

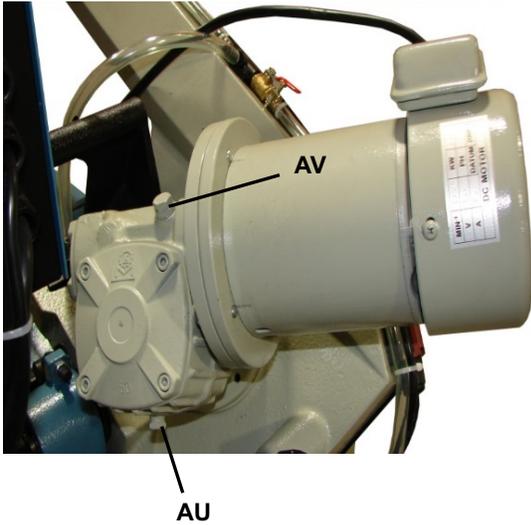


Figure 15-3

15.8 Storing Machine for Extended Period of Time

If the Band Saw is to be inactive for a long period of time, prepare the machine as follows:

- Detach the plug from the electrical supply panel.
- Clean and grease the machine.
- Release tension on the blade or remove blade.
- Drain coolant
- Cover the machine

16.0 Troubleshooting



WARNING

Make sure the electrical disconnect is OFF before working on the machine.


Table 16-1

Symptom	Possible Cause (S)	Corrective Action
Saw Motor Does Not Stop When Cut is Finished	Actuator on cylinder does not contact switch properly.	Re-adjust actuator or switch.
	Bow down limit switch SQ3 damaged	Replace SQ3
Coolant Motor Does Not Run With Band Saw Motor	Coolant switch not turned ON.	Turn on coolant switch.
	Coolant motor M2 damaged.	Replace M2 motor.
No Power Indicator Light When Main Power Turned On	Fuse may have burned out.	Switch off main power. Replace defective fuse
	Transformer T1 damaged	Replace Transformer
	Power LED HL1 damaged	Replace (white) power LED
Excessive Blade Breakage	Material loose in vise	Clamp work securely
	Incorrect speed or feed	Adjust speed or feed
	Blade tooth spacing too large	Replace with a small tooth spacing blade
	Material too coarse	Use a slow speed blade and small tooth spacing
	Incorrect blade tension	Adjust to where blade does not slip-on wheel
	Teeth in contact with material before saw is started	Start saw and lower into workpiece
	Blade rubs on wheel flange	Adjust wheel alignment
	Misaligned guide bearings	Adjust guide bearings
Cracking at weld	Weld again, note quality of weld	
Premature Blade Dulling	Teeth too coarse	Use finer teeth
	Too much speed	Decrease speed
	Inadequate feed pressure	Decrease spring tension on side of saw
	Hard spots or scale on material	Reduce speed, increase feed pressure
	Work hardening of material	Increase feed pressure by reducing spring tension
	Blade twist	Replace with a new blade, and adjust blade tension
Unusual Wear on Side/Back of Blade	Insufficient blade	Tighten blade tension adjustable knob
	Blade guides worn	Replace
	Blade guide bearings not adjusted properly	Adjust as per operator's manual
Teeth Ripping From Blade	Blade guide bearing bracket is loose	Tighten
	Teeth too coarse for work	Use finer tooth blade
	Too heavy pressure, too slow speed	Decrease pressure, increase speed
	Vibrating work piece	Clamp work piece securely
Gullets loading	Gullets loading	Use coarse tooth blade or brush to remove chips


Symptom	Possible Cause (S)	Corrective Action
Poor Cuts	Feed pressure too great	Reduce pressure by increasing spring tension on side of saw
	Guide bearing not adjusted properly	Adjust guide bearing, the clearance cannot be greater than .001 mm
	Inadequate blade tension	Increase blade tension with tension knob
	Dull blade	Replace blade
	Speed incorrect	Adjust speed
	Blade guide spaced out too much	Adjust guide space
	Blade guide assembly loose	Tighten blade guide assembly
	Blade track too far away from wheel flanges	Re-track blade according to operating instructions
Poor Cuts (Rough)	Too much speed or feed	Decrease speed or feed
	Blade is too coarse	Replace with finer blade
	Blade tension loose	Adjust blade tension
Blade is Twisting	Cut is binding blade	Decrease feed pressure
	Too much blade tension	Decrease blade tension

17.0 Replacement Parts


17.1.1 Horizontal Band Saw Assembly – Exploded View A

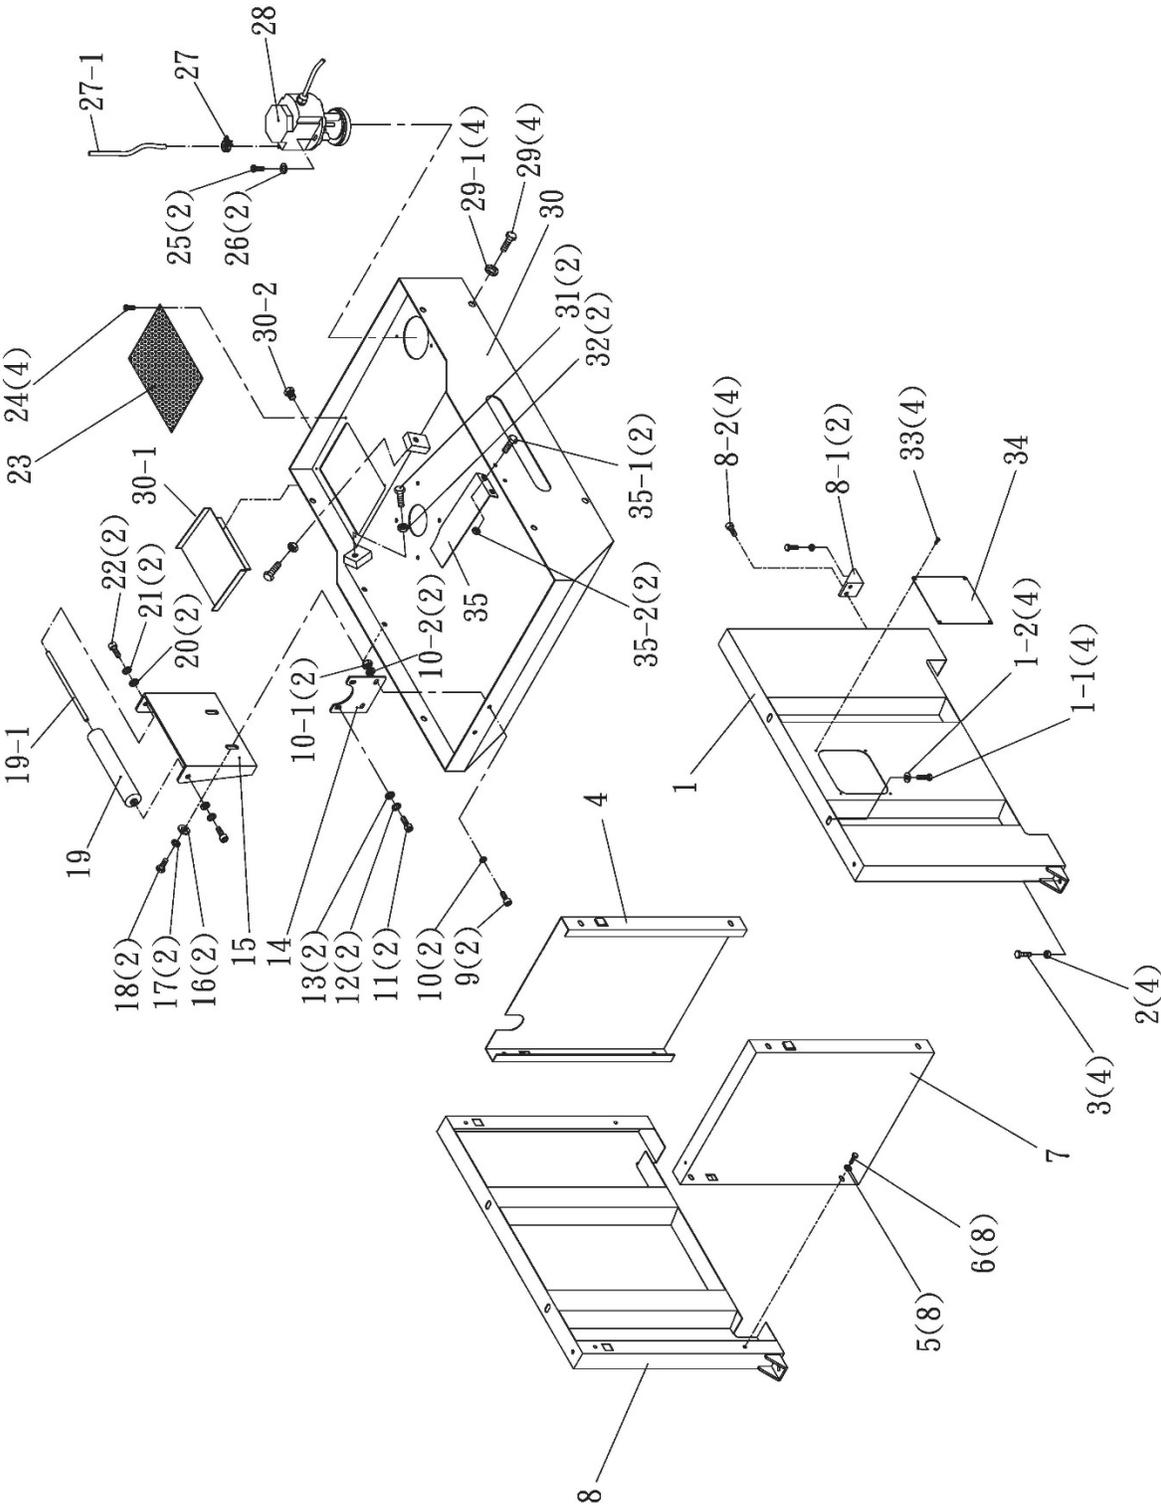

17.1.2 Horizontal Band Saw Assembly – Exploded View B

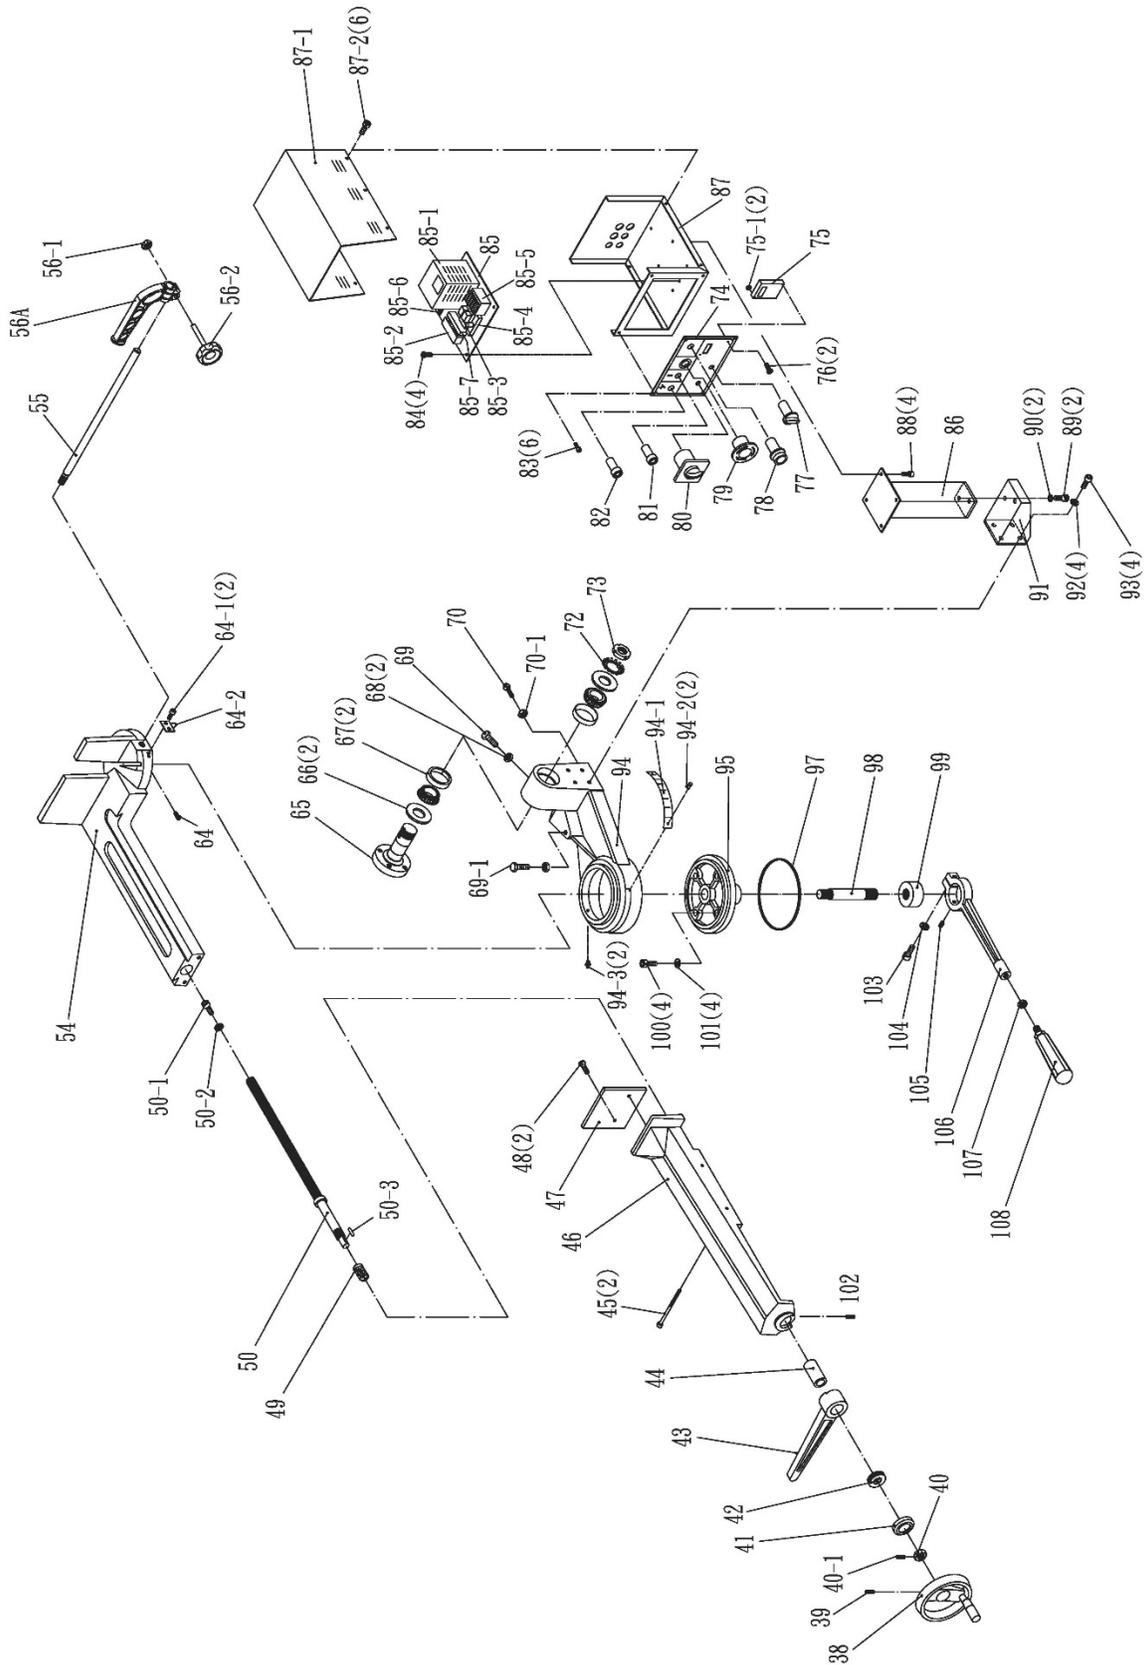

17.1.4 Horizontal Band Saw Assembly – Exploded View D

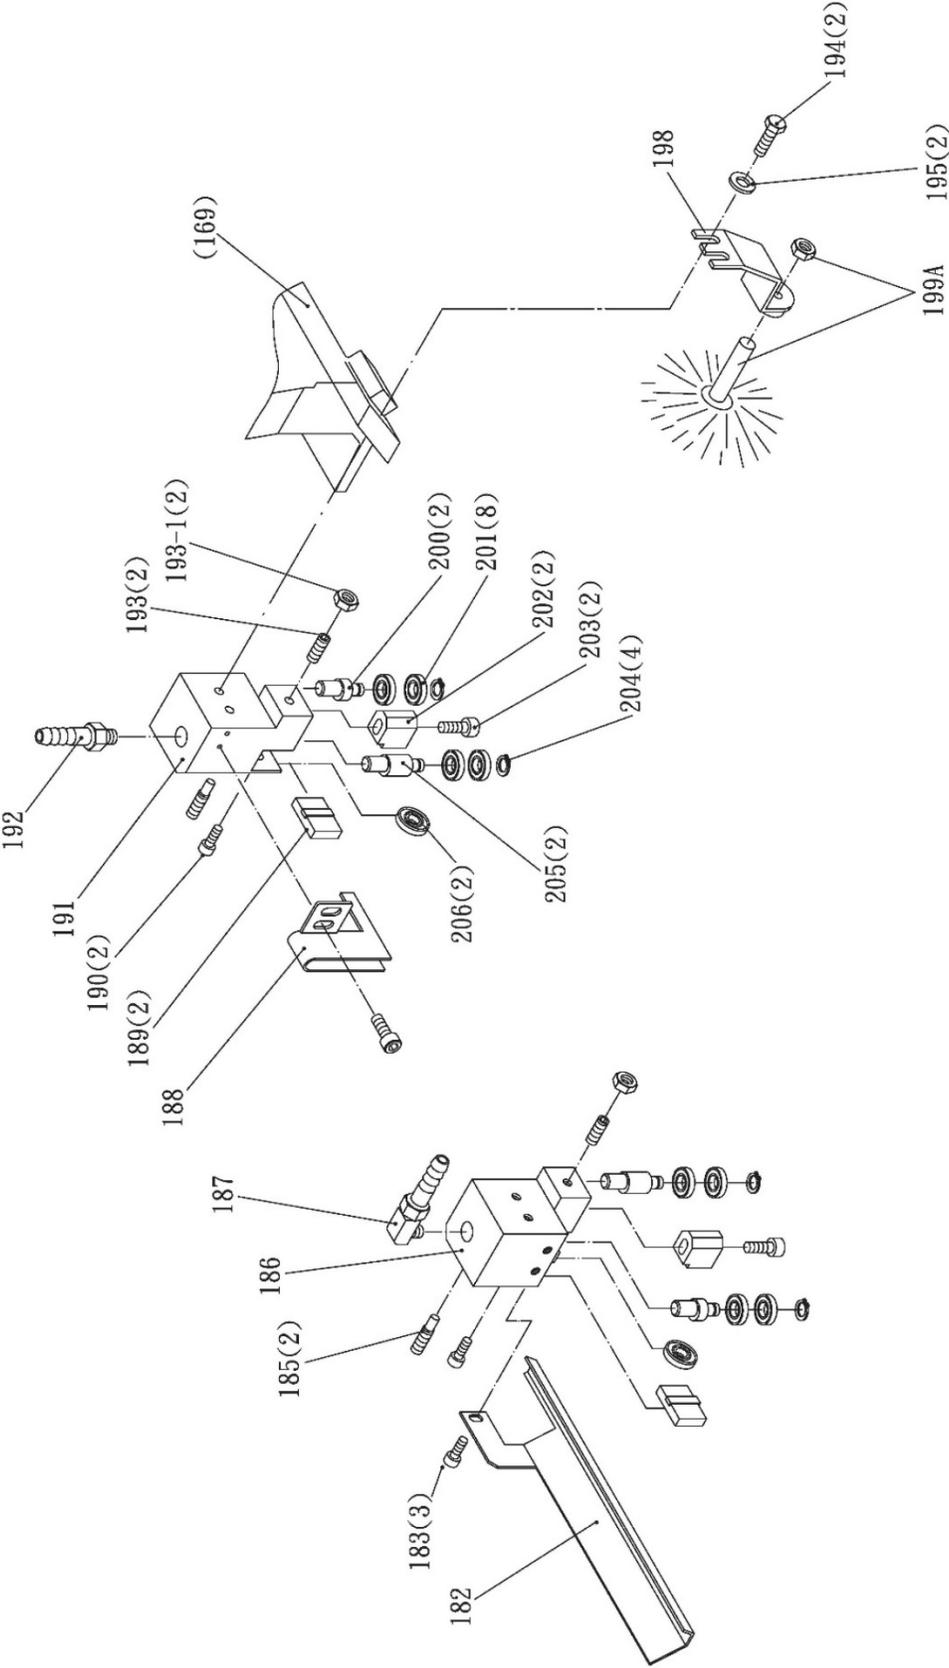

17.1.5 Horizontal Band Saw Assembly – Part List A-D

Index No	Part No	Description	Size	Qty
1	BS250M-1N	Base (Right Part)		1
1-1	JT9-TS-1491021	Hex. Cap Bolt	M10x20	4
1-2	**	Washer	M10x25x2	4
2	**	Nut	M12	4
3	JT9-TS-1492041	Hex. Cap Bolt		4
4	**	Base (Rear Part)		1
5	**	Washer	M8x18x2	8
6	JT9-TS-1490021	Hex. Cap Bolt	M8x16	8
	BA9-1001418	Manual/Hydraulic Brake Selector (85HV-1) for BS-250m		
7	**	Base (Front Part)		1
8	**	Base (Left Part)		1
8-1	**	Holder		2
8-2	CM9-TS-1504031	Hex. Socket Cap Screw	M8x16	4
9	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	2
10	**	Spring Washer	M8	2
10-1	**	Nut	M8	2
10-2	**	Washer	M8x18x2	2
11	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	2
12	**	Spring Washer	M8	2
13	**	Washer	M8x18x2	2
14	**	Supporting Plate		1
15	**	Roller Stand Bracket		1
16	**	Washer	M10x25x2	2
17	**	Spring Washer	M10	2
18	JT9-TS-1491021	Hex. Cap Bolt	M10x20	2
19	**	Roller		1
19-1	**	Roller Shaft		1
20	**	Washer	M8x18x2	2
21	**	Spring Washer	M8	2
22	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	2
23	**	Filter Net		1
24	**	Round Head Screw	M5x10	4
25	CM9-TS-1503061	Hex. Socket Cap Screw	M6x25	2
26	**	Washer	M6x13x1	2
27	**	Hose Clamp	13mm	1
27-1	**	Hose	5/16x130cm	1
28	BA9-1226701	Pump	32W 1 Ph 60Hz	1
29	CM9-TS-1491031	Hex. Cap Bolt	M10x25	4
29-1	**	Washer	M10x25x2	4
30	**	Coolant and Chip Tray		1
30-1	**	Coolant Plate		1
30-2	**	Plug	M3/8"	1
31	JT9-TS-1492041	Hex. Cap Bolt	M12x40	2
32	**	Nut	M12	2
33	JT9-TS-1502011	Hex. Socket Cap Screw	M5x8	4
34	**	Base Front Plate		1
35	**	Plate		1
35-1	JT9-TS-1482031	Hex. Cap Bolt	M6x16	2
35-2	**	Nut	M6	2
38	BA9-1226720	Hand Wheel	6-1/2"	1
39	JT9-TS-1524021	Set Screw	M8x10	1
40	BA9-1224966	Nut	M20x30x9P1.5	1
40-1	BA9-1224967	Set Screw	M5x5	1
41	BA9-1226785	Bearing Bushing		1
42	JT9-BB-51104	Thrust Ball Bearing	51104	1
43	BA9-1226747	Lock Handle		1
44	**	Bushing		1
45	BA9-1229265	Hex. Socket Cap Screw	M6x100	2


Index No	Part No	Description	Size	Qty
46	**	Movable Vise		1
47	**	Plate		1
48	**	Flat Head Machine Screw	M6x16	2
49	**	Compressed Spring	5x31x35mm	1
50	BA9-1226735	Lead Screw		1
50-1	CM9-TS-1504031	Hex. Socket Cap Screw	M8x16	1
50-2	**	Washer	M8x18x2	1
50-3	**	Key	5x5x15	1
54	BA9-1001417	Vise Table		1
55	**	Bar-Stop-Rod		1
56A	BA9-1012468	Bar-Stop	Ø19	1
56-1	**	Nut	M8	1
56-2	**	Knob	M8x30	1
64	JT9-TS-1524021	Set Screw	M8x10	1
64-1	JT9-TS-1502011	Hex. Socket Cap Screw	M5x8	2
64-2	**	Scale Pointer		1
65	BA9-1001419	Pivot		1
66	BA9-1001420	Anti-Dust Cover	30mm	2
67	JT9-BB-32006	Bearing	32006	2
68	**	Nut	M10	2
69	CM9-TS-1491031	Hex. Cap Bolt	M10x25	1
69-1	CM9-TS-1491031	Hex. Cap Bolt	M10x25	1
70	BA9-1015583	Spring Hook		1
70-1	BA9-1015584	Nut	M12	1
72	BA9-1015585	Star Washer	M30	1
73	BA9-1001423	Nut	M30xP1.5	1
74	BA9-1230198	Control Box Panel		1
75	**	Blade Speed Indicator		1
75-1	**	Nut	M3	2
76	**	Round Head Screw	M3x20	2
77	BA9-BS250M-77	Manual / Auto Selector		1
78	**	Blade Speed Knob		1
	**	Motor Blade Speed Knob		
79	BA9-1232061	Emergency Switch		1
80	**	Main Connect Switch		1
81	**	Start Push Button		1
82	**	Power Indicator Light		1
83	BA9-1230199	Round Head Screw	M5x8	6
84	**	Round Head Screw	M4x8	4
85	BA9-1227803	Control Box Bottom Plate		1
85-1	BA1-10025	Inverter		1
85-2	BA9-1227804	Terminal Connector		1
85-3	BA9-BS250M-85-3	Relay		1
85-4	BA9-1227806	Fuse	0.5A	1
85-5	BA9-1227807	Transformer		1
85-6	BA9-1227808	Grounding Plate		1
85-7	**	Wire Channel		1
86	BA9-BS250M-86	Support		1
87	BA9-1230200	Control Box Bottom Part		1
87-1	BA9-1230201	Control Box Cover		1
87-2	JT9-TS-1502011	Hex. Socket Cap Screw	M5x8	6
88	JT9-TS-1502011	Hex. Socket Cap Screw	M5x8	4
89	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	2
90	**	Spring Washer	M8	2
91	**	Setting Bracket		1
92	**	Spring Washer	M8	4
93	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	4
94	**	Swivel Arm		1
94-1	BA9-1226730	Scale		1
94-2	**	Rivet	2.3x4	2
94-3	**	Oil Inlet	1/16	2

Index No	Part No	Description	Size	Qty
95	BA9-1012905	Disk		1
97	BA9-1014366	Oil Seal	4mmx518mm	1
98	**	Shaft		1
99	**	Nut		1
100	JT9-TS-1504061	Hex. Socket Cap Screw	M8x30	4
101	**	Spring Washer	M8	4
102	JT9-TS-1524021	Set Screw	M8x10	1
103	JT9-TS-1505051	Hex. Socket Cap Screw	M10x35	1
104	**	Spring Washer	M10	1
105	JT9-TS-1525031	Set Screw	M10x16	1
106	BA9-1231764	Locking Lever		1
107	**	Nut	M12	1
108	BA9-1016456	Handle	M12x25	1
109	JT9-TS-1505041	Hex. Socket Cap Screw	M10x30	4
110	**	Spring Washer	M10	4
111	BA9-1013583	Gib		2
112	**	Spring Washer	M8	6
113	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	6
115	BA9-1013632	Front Ball Bearing Bracket		1
116	JT9-TS-1523041	Set Screw	M6x12	4
117	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	2
118	JT9-TS-1506071	Hex. Socket Cap Screw	M12x50	1
119	BA9-1013633	Setting Bracket		1
120	JT9-TS-1503011	Hex. Socket Cap Screw	M6x8	1
121	BA9-1009679	Plastic Handle	M6x60	1
122	JT9-TS-1503011	Hex. Socket Cap Screw	M6x8	2
123	**	Cover Plate		1
127A	**	Slide		1
127A-1	**	Spring Washer	M10	3
127A-2	JT9-TS-1505071	Hex. Socket Cap Screw	M10x45	3
127A-3	JT9-TS-1525051	Set Screw	M10x25	1
128	**	Nut	M16	1
129	**	Plate		1
129-1	**	Hex. Socket Cap Screw	M6x12	2
129-2	**	Washer	M6x13x1	2
130	**	Limit Switch		1
130-1	JT9-TS-1501071	Hex. Socket Cap Screw	M4x25	2
131	BA9-1016457	Handle		2
132	BA9-1227071	Handle Wheel		1
133	BA9-1231216	Thrust Spring Washer		10
134	BA9-1231217	Tension Shaft	M16x230	1
135	JT9-BB-51103	Bearing	51103	1
136	**	Blade Tension Gauge		1
136-1	**	Plate		1
137	JT9-TS-1524021	Set Screw	M8x10	2
138	**	Rod		1
139	**	Nut	M16	1
140	BA9-BS250M-140	Trigger Switch		1
141A	**	Shaft		1
142	JT9-BB-32006	Bearing	32006	2
143	BA9-1226678	Idle Flywheel		1
144	**	Anti-Dust Cover	30mm	2
145	**	Star Washer	M30	1
146	**	Jam Nut	M30xP1.5	1
147	**	Oil Inlet	1/16	1
148	**	Blade	27 x 0.9 x 2460mm HSS 5/8T	1
149	**	Blade Cover		1
150	BA9-1015878	Knob Bolt	M6x12	4
151	**	Round Head Screw	M4x8	2
154	**	Nut	M4	2

Index No	Part No	Description	Size	Qty
155	CM9-TS-1491031	Hex. Cap Bolt	M10x25	1
156	**	Spring Washer	M10	1
157	BA9-1017609	Washer		1
158	BA9-1226698	Drive Flywheel		1
159	JT9-TS-1505061	Hex. Socket Cap Screw	M10x40	4
160	**	Spring Washer	M10	4
161	**	Hose	5/16x90cm	1
162	BA9-1017845	Pipe Fitting	1/4Px5/16	1
163A	BA9-1013327	T Connector		1
164	JT9-TS-1502041	Hex. Socket Cap Screw	M5x16	2
165	**	Coolant Switch	1/4Px5/16	2
166	**	Hose Clamp	13mm	1
168	**	Hose	5/16x40cm	1
169	BA9-1012509	Saw Arm		1
170	**	Limit Switch		1
170-1	**	Switch Pin		1
171	CM9-TS-1501081	Hex. Socket Cap Screw	M4x30	2
172H-1	**	Spring Shaft		1
172H-2	**	Setting Plate		1
172H-3	**	Handle		1
172H-4	**	Nut	M16	2
172H-5	**	Bushing		1
172H-6	**	Adjustable Shaft	16x160mm	1
172H-7	**	Spring	6x50x188mm	1
172H-8	JT9-TS-1524021	Set Screw	M8x10	3
172H-9	**	Washer	M16x30x3	1
174	BA9-1009853	Key	6x6x30	1
175	BA9-1021259	Motor		1
175-1	BA9-1021791	Junction Box		1
176	**	Spring Washer	M8	4
177	JT9-TS-1490051	Hex. Cap Bolt	M8x30	4
178	BA9-1011823	Gear Box		1
178-1	**	Vent Screw		1
178-2	**	Key	8x7x30	1
179	JT9-TS-1523041	Set Screw	M6x12	4
181	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	2
182	BA9-1013584	Front Blade Guard		1
183	**	Hex. Socket Cap Screw	M6x8	3
185	BA9-1013585	Bolt		2
186	BA9-1001397	Front Ball Bearing Seat		1
187	**	Pipe Fitting	1/4Px5/16	1
188	BA9-1001398	Rear Blade Guard		1
189	BA9-1001399	Blade Guide		2
190	JT9-TS-1503011	Hex. Socket Cap Screw	M6x8	2
191	BA9-1001402	Rear Ball Bearing Seat		1
192	**	Pipe Fitting	1/4Px5/16	1
193	JT9-TS-1523041	Set Screw	M6x12	2
193-1	BA9-1001404	Nut	M6	2
194	JT9-TS-1482021	Hex. Cap Bolt	M6x12	2
195	**	Washer	M6x13x1	2
198	BA9-1001407	Bracket		1
199A	BA1-9643	Brush	Ø50	1
200	BA9-1001409	Eccentric Shaft		2
201	JT9-BB-608ZZ	Ball Bearing	608ZZ	8
202	BA9-1001411	Blade Guide		2
203	CM9-TS-1503061	Hex. Socket Cap Screw	M6x25	2
204	BA9-BS250M-204	E Ring	E-7	4
205	BA9-1001414	Centric Shaft		2
206	JT9-BB-608ZZ	Ball Bearing	608ZZ	2

** These parts are shown for reference only and are not available for order individually. Non-proprietary parts, such as fasteners, can usually be found at local hardware stores.

17.1.6 Horizontal Band Saw Assembly – Exploded View E

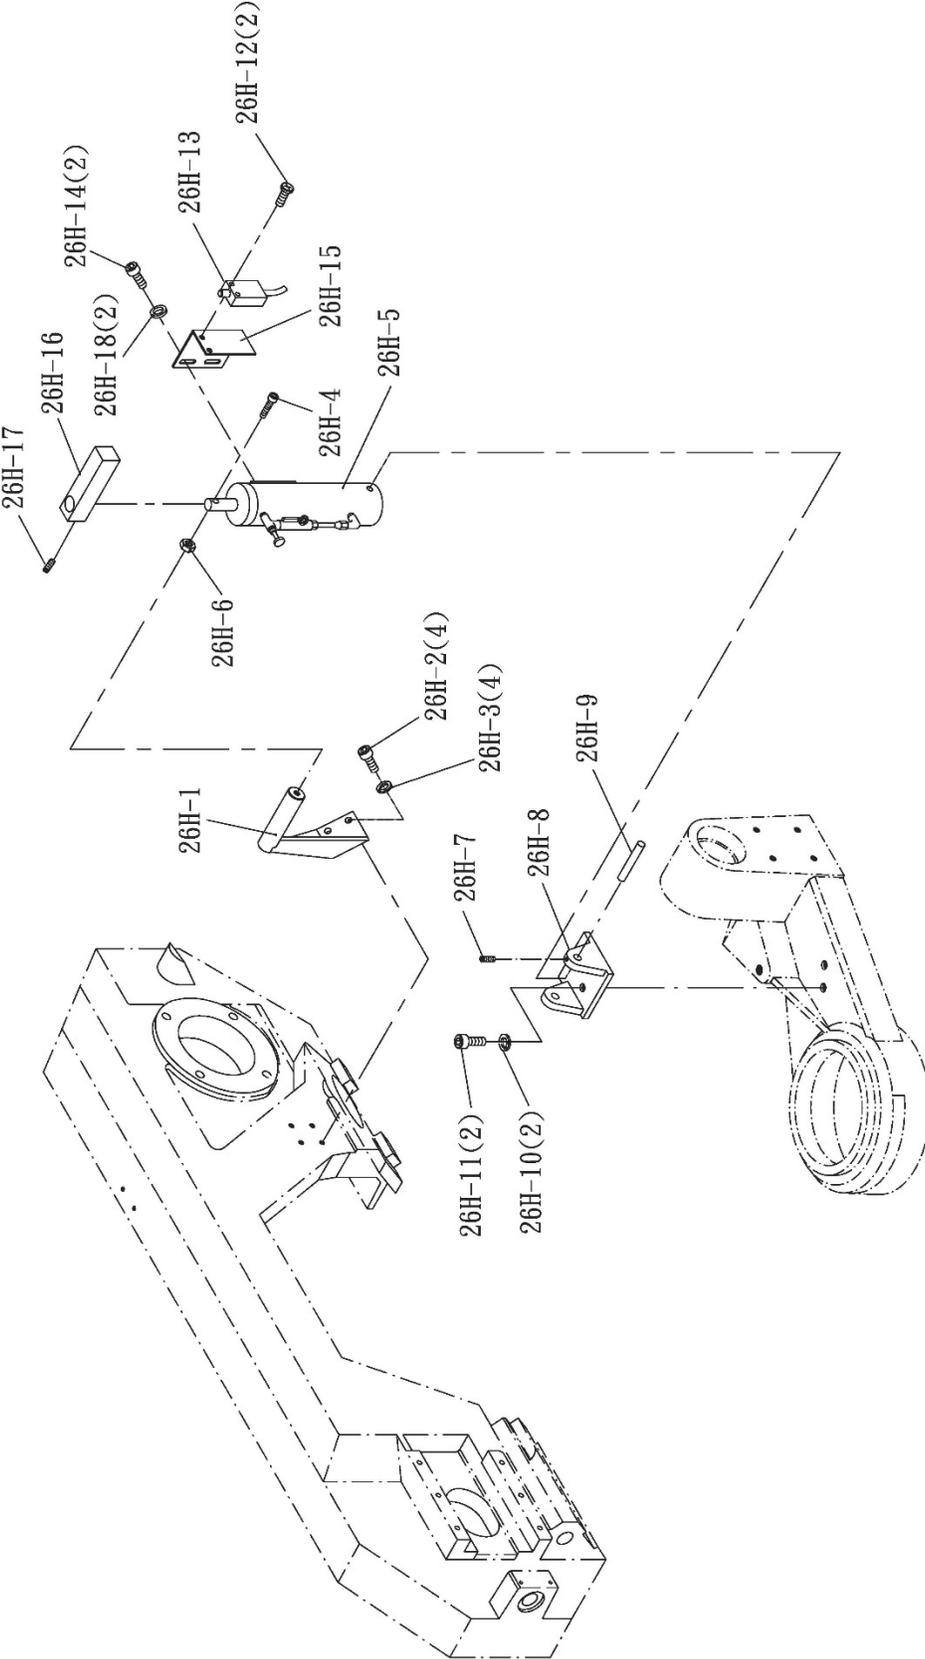


17.1.7 Horizontal Band Saw Assembly – Part List E

Index No	Part No	Description	Size	Qty
26H-1	**	Top Support		1
26H-2	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	4
26H-3	**	Spring Washer	M8	4
26H-4	JT9-TS-1505061	Hex. Socket Cap Screw	M10x40	1
26H-5	**	Hydraulic Cylinder		1
26H-6	**	Nut	M10	1
26H-7	JT9-TS-1523041	Set Screw	M6x12	1
26H-8	**	Bottom Support		1
26H-9	**	Support Rod		1
26H-10	**	Spring Washer	M8	2
26H-11	JT9-TS-1504041	Hex. Socket Cap Screw	M8x20	2
26H-12	**	Round Head Screw	M5x10	2
26H-13	BA9-BS250M-E13	Limit Switch		1
26H-14	JT9-TS-1503011	Hex. Socket Cap Screw	M6x8	2
26H-15	**	Adjusting Bracket		1
26H-16	**	Setting Bracket		1
26H-17	JT9-TS-1523041	Set Screw	M6x12	1
26H-18	**	Washer	M6	2

** These parts are shown for reference only and are not available for order individually. Non-proprietary parts, such as fasteners, can usually be found at local hardware stores.

18.0 Wiring Diagram













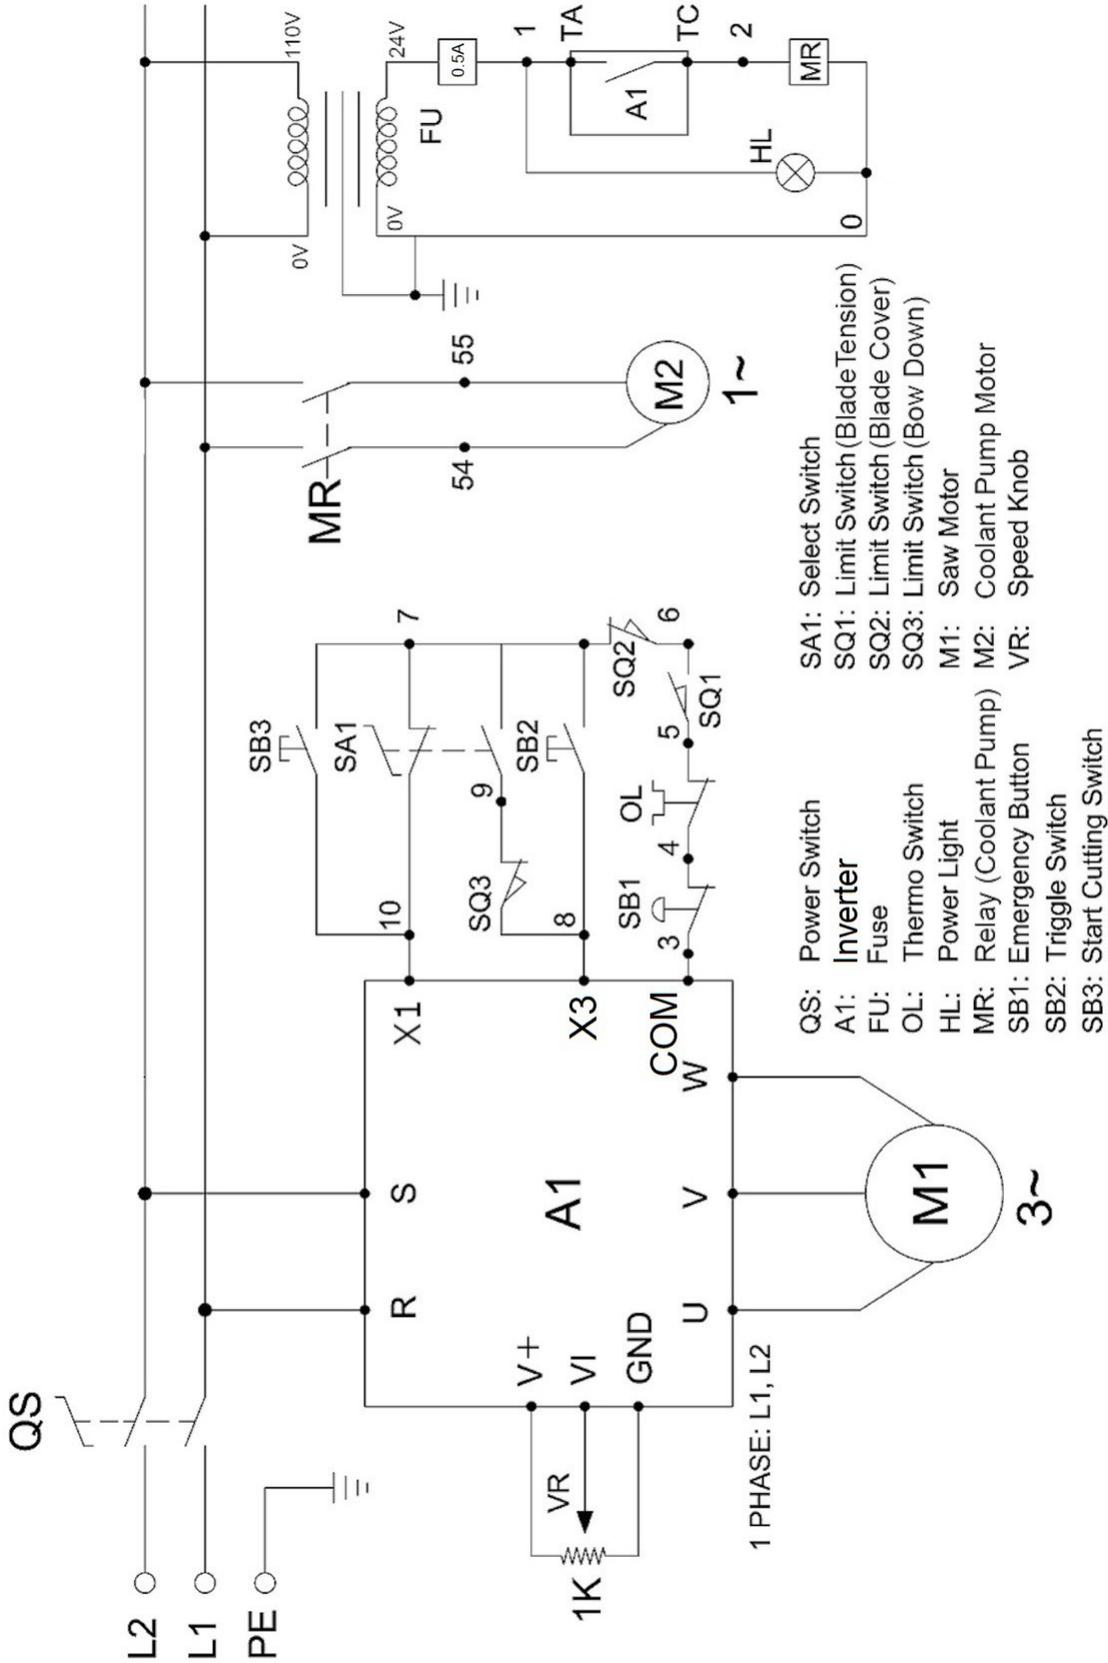


             - QS: Power Switch
- A1: Inverter
- FU: Fuse
- OL: Thermo Switch
- HL: Power Light
- MR: Relay (Coolant Pump)
- SB1: Emergency Button
- SB2: Triggler Switch
- SB3: Start Cutting Switch
- SA1: Select Switch
- SQ1: Limit Switch (Blade Tension)
- SQ2: Limit Switch (Blade Cover)
- SQ3: Limit Switch (Bow Down)
- M1: Saw Motor
- M2: Coolant Pump Motor
- VR: Speed Knob

19.0 Fault Displays

 
 
 
 
 
 
 
 
 
 
 
19.1 Error Trip Messages of Drive

Table 19-1

Display	Description	Display	Description
Fot 	IGBT module error	noFb 	PID feedback signal error
GF 	Grounding fault	AdEr 	A/D converter error
OC 	Drive over current	EF 	External fault
OL 	Motor overload	PAdF 	Keypad interruption during copy
OL1 	Drive overload	EEr 	EEPROM error
OL2 	Drive current limit	EEr1 	Internal memory error
OL3 	Braking transistor overload	EEr2 	Internal memory error
OLO 	System overload	ntcF 	Thermal sensor fault
OE 	Over voltage	OH 	Drive overheat
LE1 	Under voltage during operation	OH2 	Motor overheat

19.2 Warning Messages of Drive

Table 19-2

Display	Description	Display	Description
OLO 	System overload	Fr 	Coast to stop
Hv 	Power source over voltage	dtF 	Forward/reverse command input simultaneously
db 	Braking transistor is active	WrF 	Different software version inter-copy
LE* 	Power source under voltage*	Cot 	Modbus communication overtime
Oht 	Drive overheat	Err 00 	Keypad cable trip before connecting
OH1 	Motor overheat	Err 01 	Keypad cable trip during operation
Bb 	Drive output interruption	PUF1 	First time you enter wrong
PUF2 	Second time you enter wrong	PUF3 	Third time you enter wrong
LOC 	Parameter locking	ULOC 	Parameter Password Unlock

Note: *The LE error message will display briefly when power is removed from the machine. This is normal as it is accurately reading a loss of power.

20.0 Warranty and Service

Thank you for your purchase of a machine from Baileigh Industrial. We hope that you find it productive and useful to you for a long time to come.

Inspection & Acceptance. Buyer shall inspect all Goods within ten (10) days after receipt thereof. Buyer's payment shall constitute final acceptance of the Goods and shall act as a waiver of the Buyer's rights to inspect or reject the Goods unless otherwise agreed. If Buyer rejects any merchandise, Buyer must first obtain a Returned Goods Authorization ("RGA") number before returning any Goods to Seller. Goods returned without an RGA will be refused. Seller will not be responsible for any freight costs, damages to Goods, or any other costs or liabilities pertaining to Goods returned without an RGA. Seller shall have the right to substitute a conforming tender. Buyer will be responsible for all freight costs to and from Buyer and repackaging costs, if any, if Buyer refuses to accept shipment. If Goods are returned in unsalable condition, Buyer shall be responsible for full value of the Goods. Buyer may not return any special-order Goods. Any Goods returned hereunder shall be subject to a restocking fee equal to 30% of the invoice price.

Specifications. Seller may, at its option, make changes in the designs, **specifications**, or components of the Goods to improve the safety of such Goods, or if in Seller's judgment, such changes will be beneficial to their operation or use. Buyer may not make any changes in the specifications for the Goods unless Seller approves of such changes in writing, in which event Seller may impose additional charges to implement such changes.

Limited Warranty. Seller warrants to the original end-user that the Goods manufactured or provided by Seller under this Agreement shall be free of defects in material or workmanship for a period of twelve (12) months from the date of purchase, provided that the Goods are installed, used, and maintained in accordance with any instruction manual or technical guidelines provided by the Seller or supplied with the Goods, if applicable. The original end-user must give written notice to Seller of any suspected defect in the Goods prior to the expiration of the warranty period. The original end-user must also obtain an RGA from Seller prior to returning any Goods to Seller for warranty service under this paragraph. Seller will not accept any responsibility for Goods returned without an RGA. The original end-user shall be responsible for all costs and expenses associated with returning the Goods to Seller for warranty service. In the event of a defect, Seller, at its sole option, shall repair or replace the defective Goods or refund to the original end-user the purchase price for such defective Goods. Goods are not eligible for replacement or return after a period of 10 days from date of receipt. The foregoing warranty is Seller's sole obligation, and the original end-user's exclusive remedy, with regard to any defective Goods. This limited warranty does not apply to: (a) die sets, tooling, and saw blades; (b) periodic or routine maintenance and setup, (c) repair or replacement of the Goods due to normal wear and tear, (d) defects or damage to the Goods resulting from misuse, abuse, neglect, or accidents, (f) defects or damage to the Goods resulting from improper or unauthorized alterations, modifications, or changes; and (f) any Goods that has not been installed and/or maintained in accordance with the instruction manual or technical guidelines provided by Seller.

EXCLUSION OF OTHER WARRANTIES. THE FOREGOING LIMITED WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED. ANY AND ALL OTHER EXPRESS, STATUTORY, OR IMPLIED WARRANTIES, INCLUDING BUT NOT LIMITED TO, ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE ARE EXPRESSLY DISCLAIMED. NO WARRANTY IS MADE WHICH EXTENDS BEYOND THAT WHICH IS EXPRESSLY CONTAINED HEREIN.

Limitation of Liability. IN NO EVENT SHALL SELLER BE LIABLE TO BUYER OR ANY OTHER PARTY FOR ANY INCIDENTAL, CONSEQUENTIAL OR SPECIAL DAMAGES (INCLUDING, WITHOUT LIMITATION, LOST PROFITS OR DOWN TIME) ARISING FROM OR IN MANNER CONNECTED WITH THE GOODS, ANY BREACH BY SELLER OR ITS AGENTS OF THIS AGREEMENT, OR ANY OTHER CAUSE WHATSOEVER, WHETHER BASED ON CONTRACT, TORT OR ANY OTHER THEORY OF LIABILITY. BUYER'S REMEDY WITH RESPECT TO ANY CLAIM ARISING UNDER THIS AGREEMENT IS STRICTLY LIMITED TO NO MORE THAN THE AMOUNT PAID BY THE BUYER FOR THE GOODS.

Force Majeure. Seller shall not be responsible for any delay in the delivery of, or failure to deliver, Goods due to causes beyond Seller's reasonable control including, without limitation, acts of God, acts of war or terrorism, enemy actions, hostilities, strikes, labor difficulties, embargoes, non-delivery or late delivery of materials, parts and equipment or transportation delays not caused by the fault of Seller, delays caused by civil authorities, governmental regulations or orders, fire, lightning, natural disasters or any other cause beyond Seller's reasonable control. In the event of any such delay, performance will be postponed by such length of time as may be reasonably necessary to compensate for the delay.

Installation. If Buyer purchases any Goods that require installation, Buyer shall, at its expense, make all arrangements and connections necessary to install and operate the Goods. Buyer shall install the Goods in accordance with any Seller instructions and shall indemnify Seller against any and all damages, demands, suits, causes of action, claims and expenses (including actual attorneys' fees and costs) arising directly or indirectly out of Buyer's failure to properly install the Goods.

Work By Others; Safety Devices. Unless agreed to in writing by Seller, Seller has no responsibility for labor or work performed by Buyer or others, of any nature, relating to design, manufacture, fabrication, use, installation, or provision of Goods. Buyer is solely responsible for furnishing and requiring its employees and customers to use all safety devices, guards and safe operating procedures required by law and/or as set forth in manuals and instruction sheets furnished by Seller. Buyer is responsible for consulting all operator manuals, ANSI or comparable safety standards, OSHA regulations and other sources of safety standards and regulations applicable to the use and operation of the Goods.

Remedies. Each of the rights and remedies of Seller under this Agreement is cumulative and in addition to any other or further remedies provided under this Agreement or at law or equity.

Attorney's Fees. In the event legal action is necessary to recover monies due from Buyer or to enforce any provision of this Agreement, Buyer shall be liable to Seller for all costs and expenses associated therewith, including Seller's actual attorney fees and costs.

Governing Law/Venue. This Agreement shall be construed and governed under the laws of the State of Wisconsin, without application of conflict of law principles. Each party agrees that all actions or proceedings arising out of or in connection with this Agreement shall be commenced, tried, and litigated only in the state courts sitting in Manitowoc County, Wisconsin or the U.S. Federal Court for the Eastern District of Wisconsin. Each party waives any right it may have to assert the doctrine of "forum non conveniens" or to object to venue to the extent that any proceeding is brought in accordance with this section. Each party consents to and waives any objection to the exercise of personal jurisdiction over it by courts described in this section. Each party waives to the fullest extent permitted by applicable law the right to a trial by jury.

Summary of Return Policy:

- 10 Day acceptance period from date of delivery. Damage claims and order discrepancies will not be accepted after this time.
- You must obtain a Baileigh Industrial issued RGA number PRIOR to returning any materials.
- Returned materials must be received at Baileigh Industrial in new condition and in original packaging.
- Altered items are not eligible for return.
- Buyer is responsible for all shipping charges.
- A 30% re-stocking fee applies to all returns.

Baileigh Industrial makes every effort to ensure that our posted specifications, images, pricing, and product availability are as correct and timely as possible. We apologize for any discrepancies that may occur. Baileigh Industrial reserves the right to make any and all changes deemed necessary in the course of business including but not limited to pricing, product specifications, quantities, and product availability.

For Customer Service & Technical Support:

Please contact one of our knowledgeable Sales and Service team members at:
(920) 684-4990 or e-mail us at Baileigh-Service@jpwindustries.com



BAILEIGH INDUSTRIAL

1625 DUFEK DRIVE MANITOWOC, WI 54220

PHONE: 920.684.4990 FAX: 920.684.3944

www.baileigh.com